



Inspection Report (FRI)

IO#MT-20260514-001

GENERAL INFORMATION

Client: Zoe Furnconsult Ltd	
Product:	WHITBY CHAIR WHITBY CHAIR WHITBY COUNTER
Inspection location:	Huzhou Zhejiang
Inspection date:	2026-05-14
Your reference number:	109010.001 109010.002 109011.002
PO number:	PO EB0018921
Supplier:	Unique Furniture A/S
Order quantity:	326 pcs
Qty ready for inspection (%):	326 pcs(100%)
Reference sample available:	Yes



INSPECTION RESULT

OVERALL RESULT	Pending				
CRITERIA	RESULTS	REMARKS			
1. Quantity	Confirm				
2. Production Status/specification	Confirm				
3. Packing and marking	Pending	1			
4. On-site tests & special requirement	Confirm				
5. WORKMANSHIP AQL:	Within AQL	CRI	MAJ	MIN	
		Found	0	0	2
		Max	0	3	5
		Checked	50	50	50

REMARKS

1. The outer packaging boxes of 109010.001 and 109010.002 do not bear the FSC logo, and an additional number "7057 72323" was printed.



		<p>Article Number: 109010.001 PO Number: EB0018921 Package No: Total number of package: G.W. 10.4 KGS N.W. 8.6 KGS</p>	<p>Article Number: 109010.001 PO Number: EB0018921 Package No: Total number of package: G.W. 10.4 KGS N.W. 8.6 KGS</p>
		MADE IN CHINA	MADE IN CHINA

SHIPPING MARK MICASA 5043 5040
 BOX DIMENSION : W540xD490xH500mm



		<p>Article Number: 109010.002 PO Number: EB0018921 Package No: Total number of package: G.W. 10.4 KGS N.W. 8.6 KGS</p>	
		MADE IN CHINA	

SHIPPING MARK MICASA 5043 5060
 BOX DIMENSION : W540xD490xH500mm





INSPECTION STANDARDS	
Inspection type	Final Random Inspection (FRI)
Sampling standard	ANSI/ASQ Z1.4-2003 (Equivalent to ISO 2859-1 or MIL-STD-105E)
Sampling Plan (Single)	II
AQL for Critical/ Major/ Minor	Not Allowed/2.5/4.0
Sampling size for Cri/Maj/Min	50/50/50
No. of cartons selected and inspected	26 cartons
Number list of selected cartons/packages	109010.001:28,23,7,41,15,49,32,8 109010.002:1,37,26,8,31,16,12,5 109011.002:17,47,25,20,33,13,6,58,19,41

1. Quantity	Result	Actual Finding / Comments
80%of the total order quantity must be packed. and 100% finished - order qty:	OK	All packed

Item/PO #	Order qty	Finished qty	Unfinished qty	Packed qty	Unpacked qty	Sample size
109010.001	100	100	0	100	0	15
109010.002	100	100	0	100	0	15
109011.002	126	126	0	126	0	20
Total:	326	326	0	326	0	50

Pictures:



2.Product Status:	Result	Problem Comments
		OK
2A. Product colour/design/specification		Consistent with the sample signature
Client's expected:		See below photos




Item No.	Spec./ref. sample	Sample 1	Sample 2	Sample 3
109010.001				
Size (cm)	51.5x44x84.5	51.5x44x84.5	51.5x44x84.5	51.5x44x84.5
Net weight (Kg)	4.25	4.25	4.20	4.25
Item No.	Spec./ref. sample	Sample 1	Sample 2	Sample 3
109010.002				
Size (cm)	50.5x44x84.5	50.5x44x84.5	50.5x44x84.5	50.5x44x84.5
Net weight (Kg)	4.20	4.25	4.20	4.25
Item No.	Spec./ref. sample	Sample 1	Sample 2	Sample 3
109011.002				
Size (cm)	44x42.5x92.5	44x42.5x92.5	44x42.5x92.5	44x42.5x92.5
Net weight (Kg)	4.80	4.80	4.80	4.85

Pictures:

Item: 109010.001





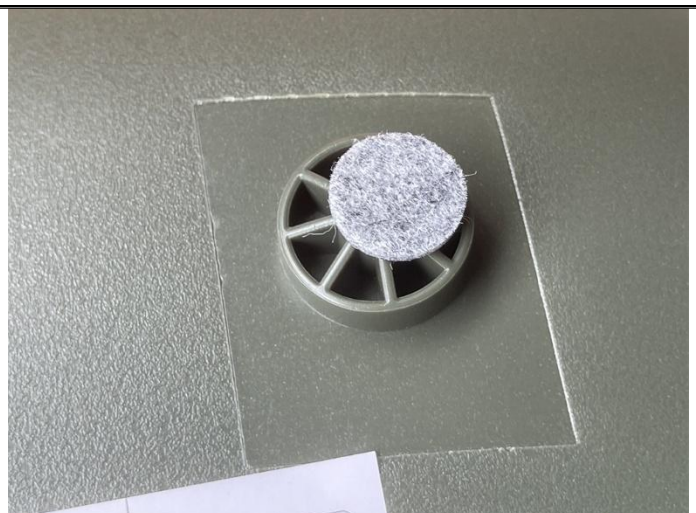








Item: 109010.002

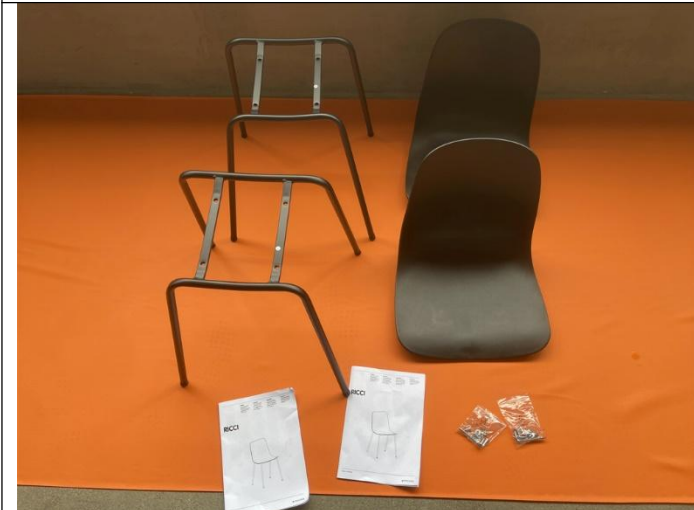











Item: 109011.002















3. Packing and Marking	Result	Problem Comments
		Pending
3A. Shipping Marks/carton weight		Actual Finding
A1. Carton Mark		See below photos
A2. Weight of carton:		109010.001:10.5kg 109010.002:10.4kg 109011.002:12.3kg
3B. Packing and dimension		Actual Finding
Client's comments:		
B1. Outer packing method and dimension L: cm x W: cm x H: cm		109010.001: 2pc/carton-54x50x51.5cm 109010.002: 2pc/carton-54x49.5x51.5cm 109011.002: 2pc/carton-73x50.5x50.5cm



Pictures:


Item: 109010.001







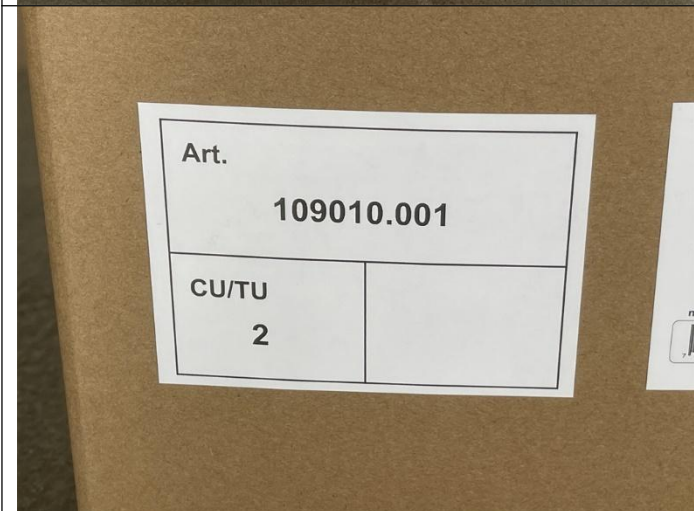


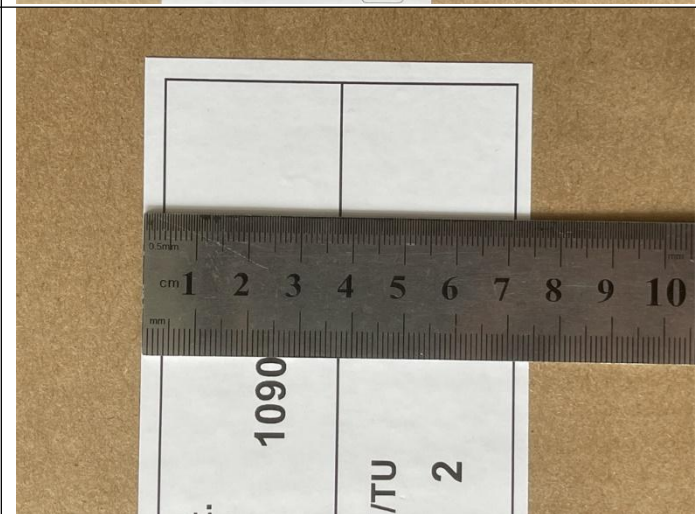

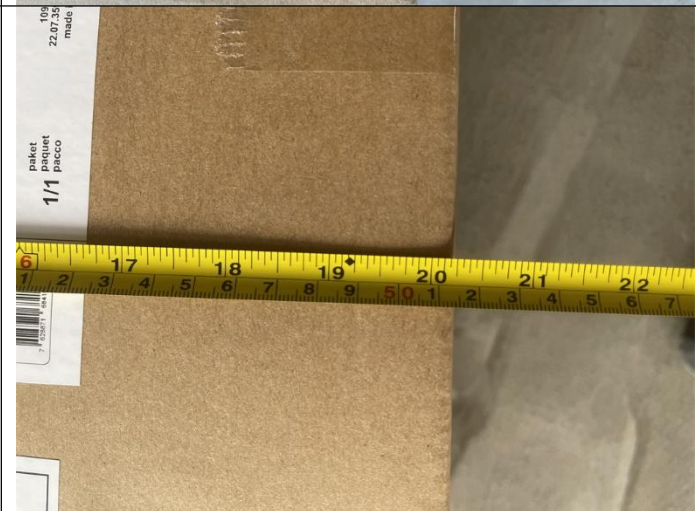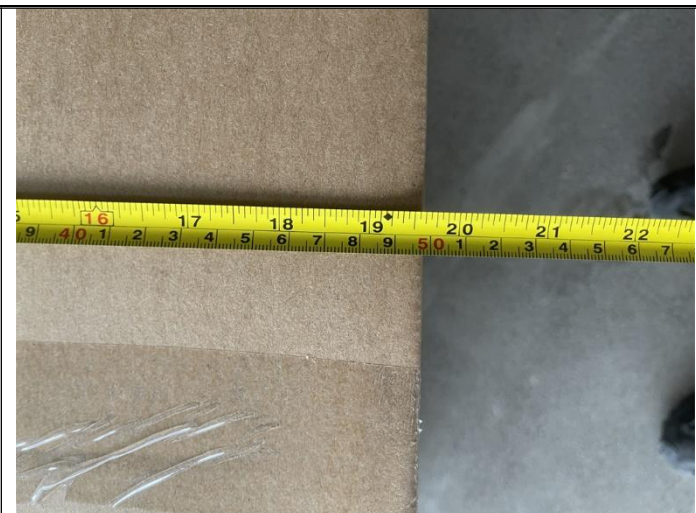



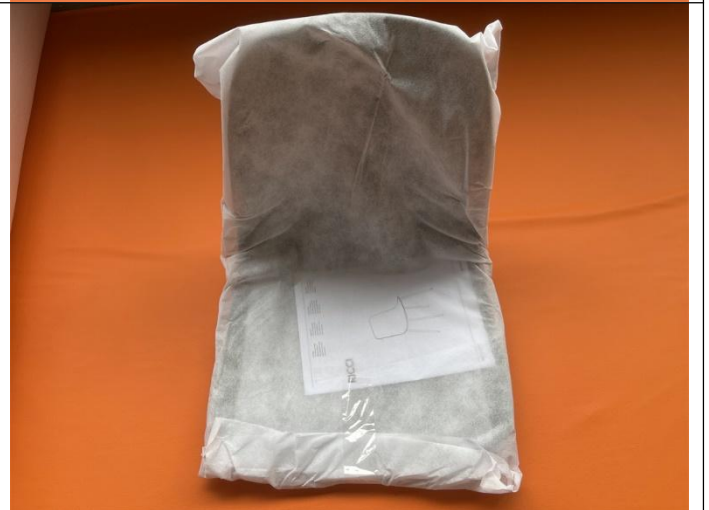


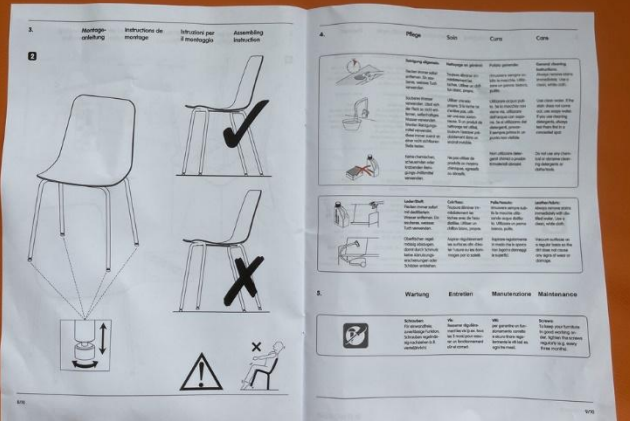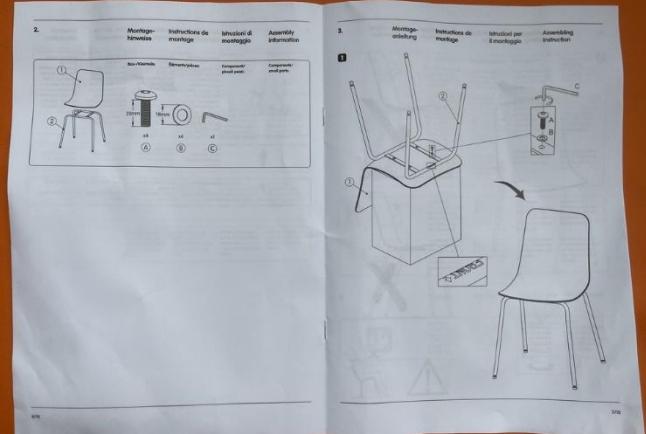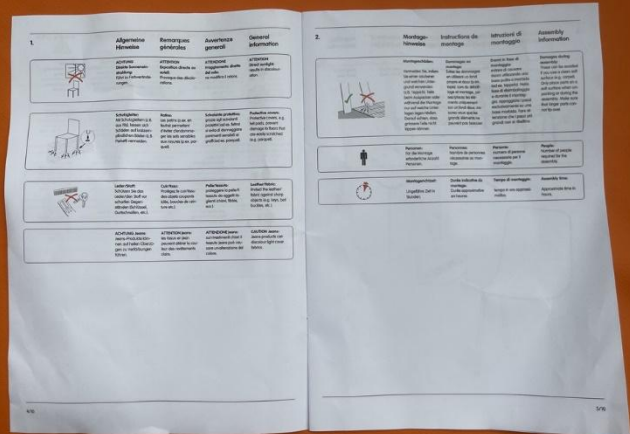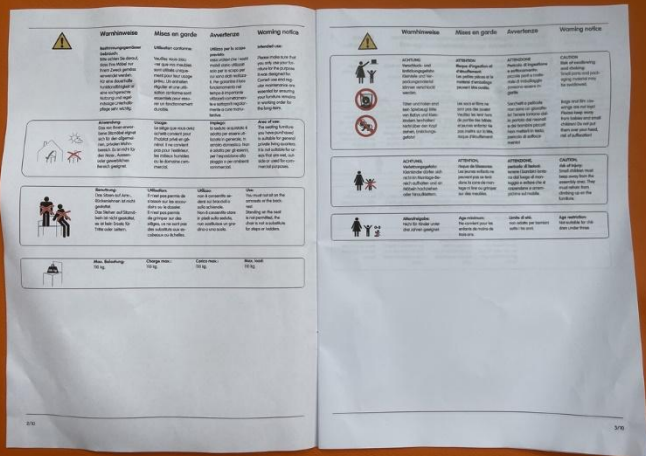


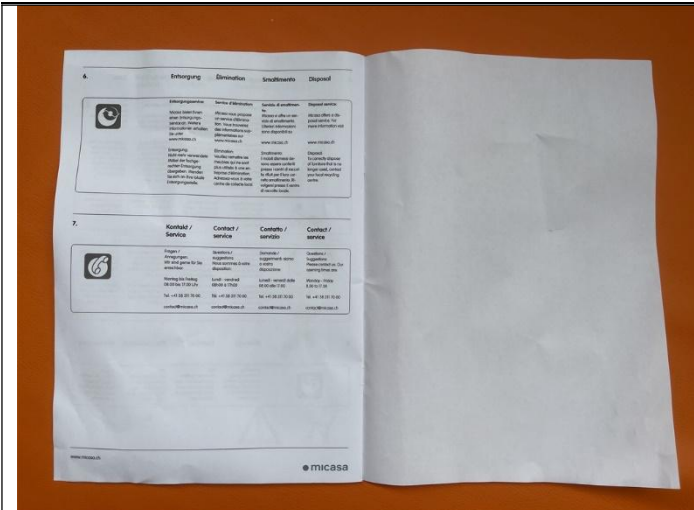


Item: 109010.002




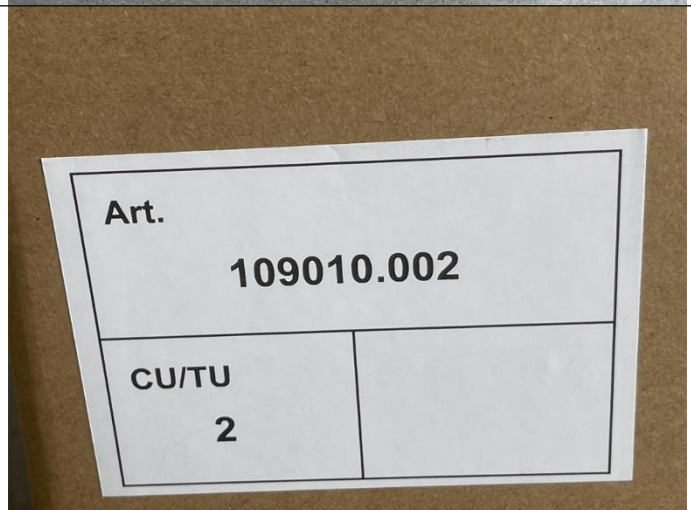


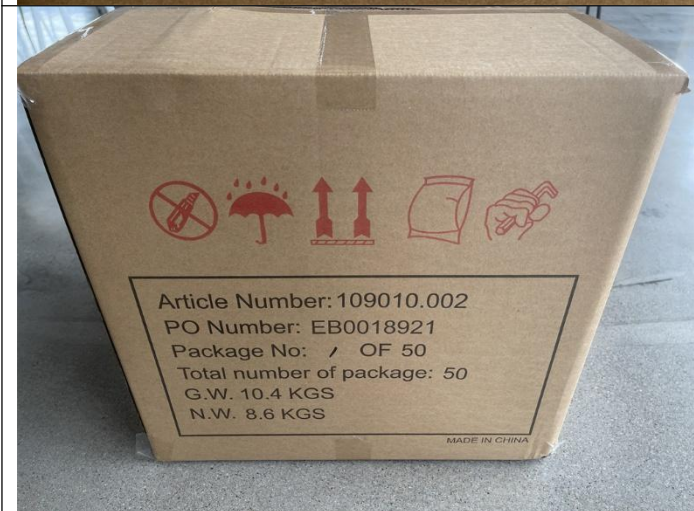
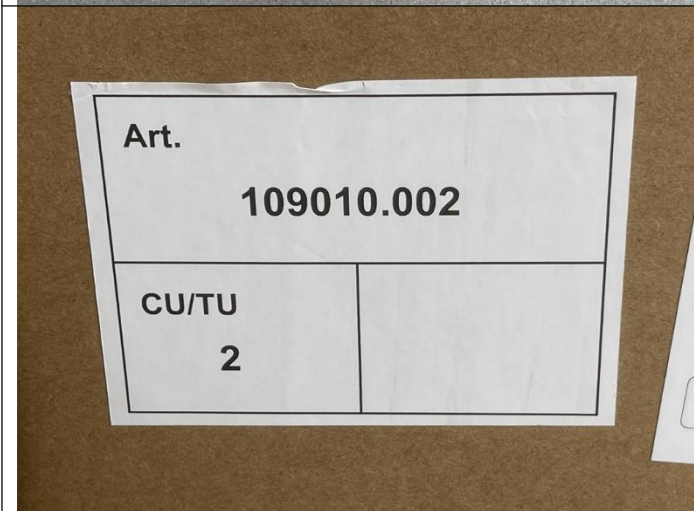


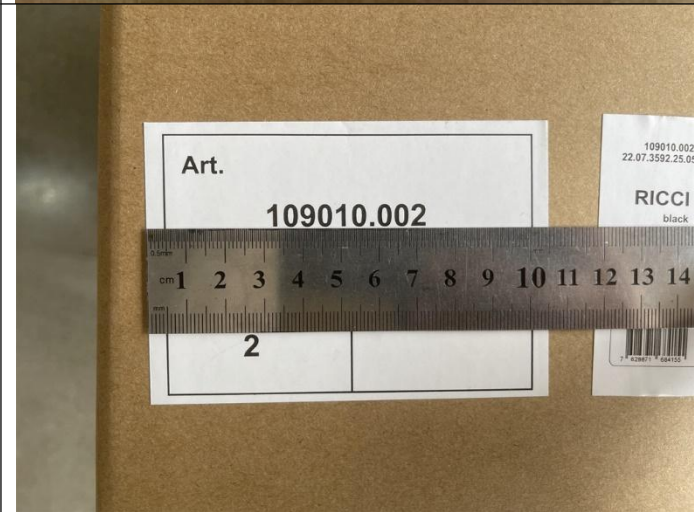

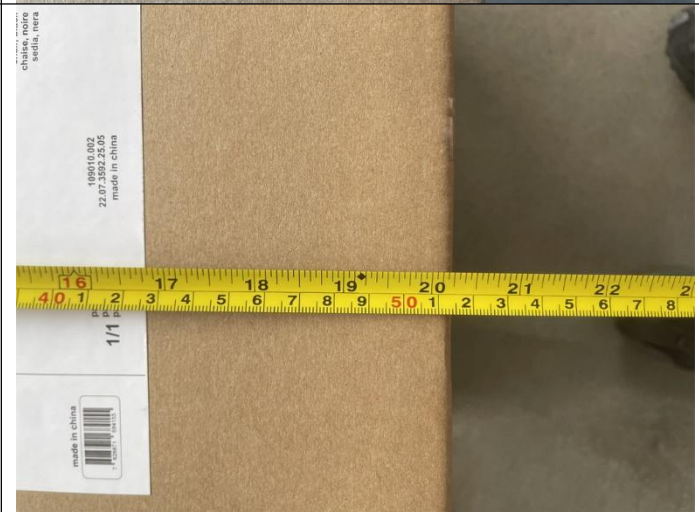





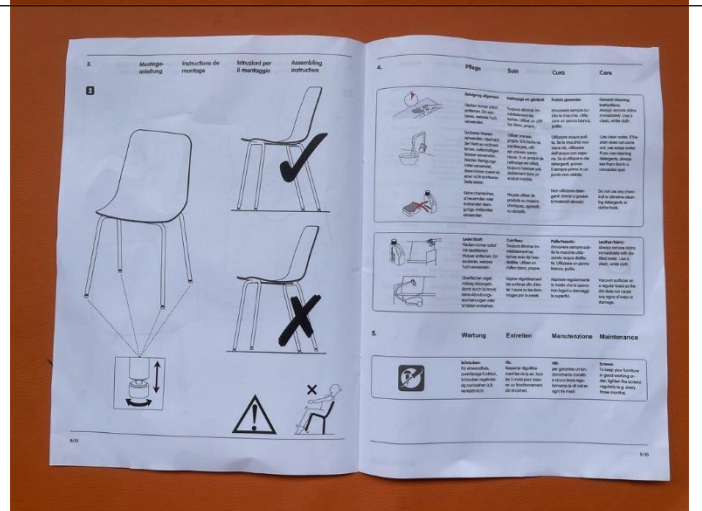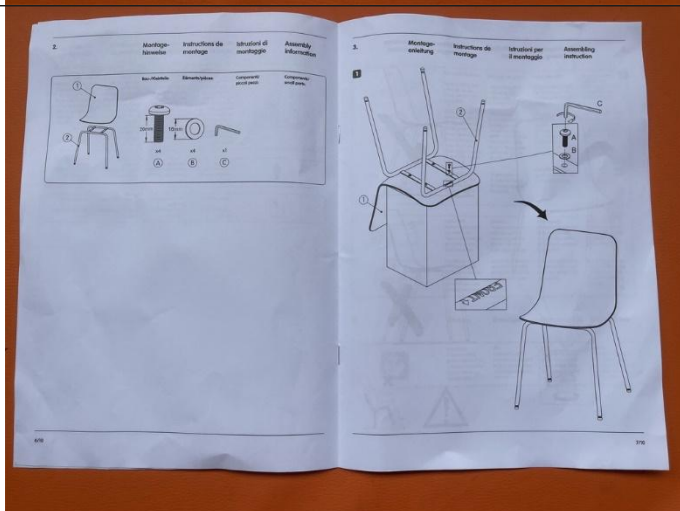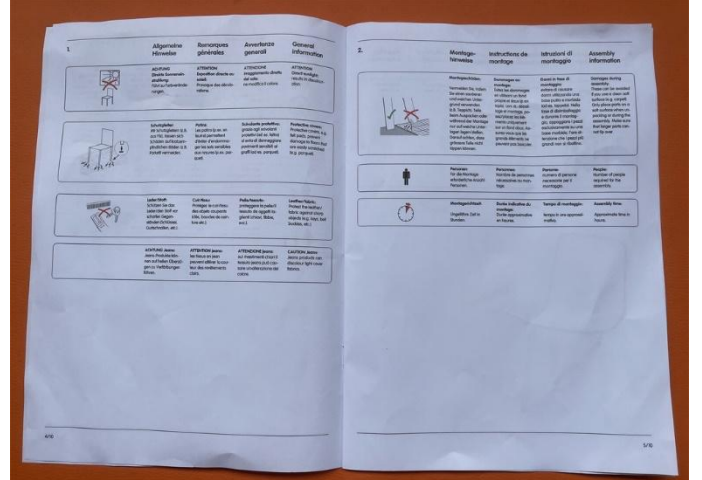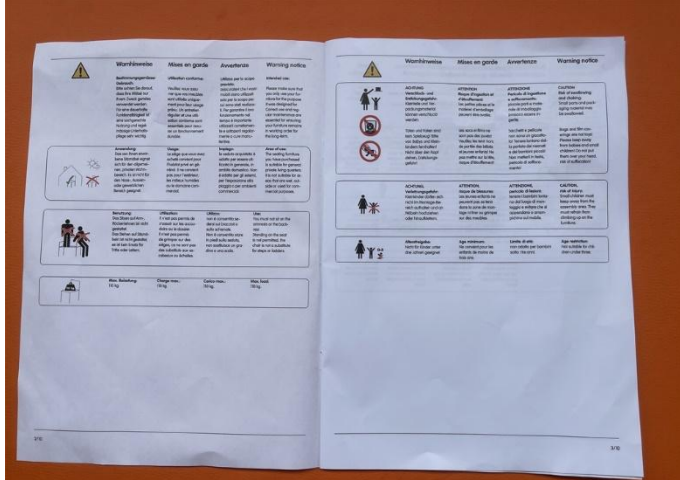


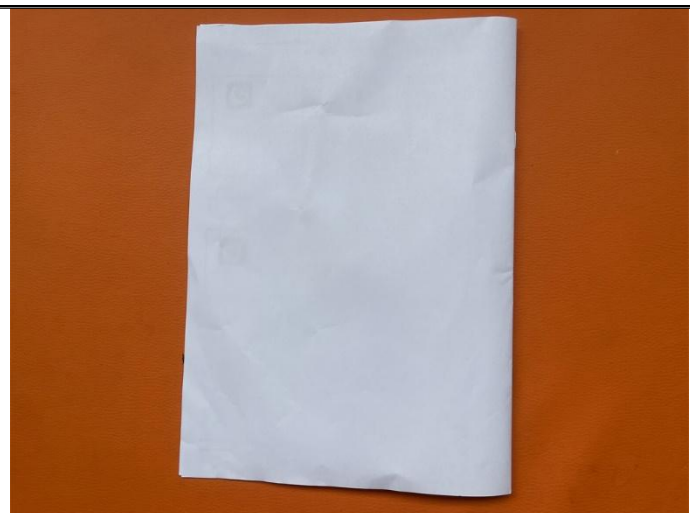
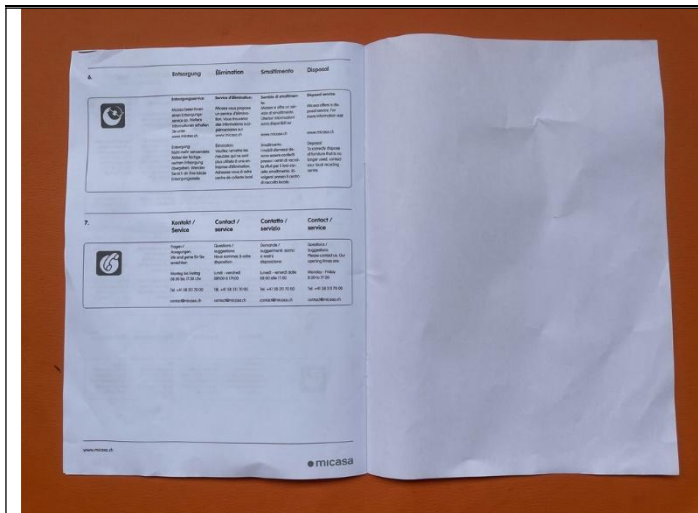


Item: 109011.002




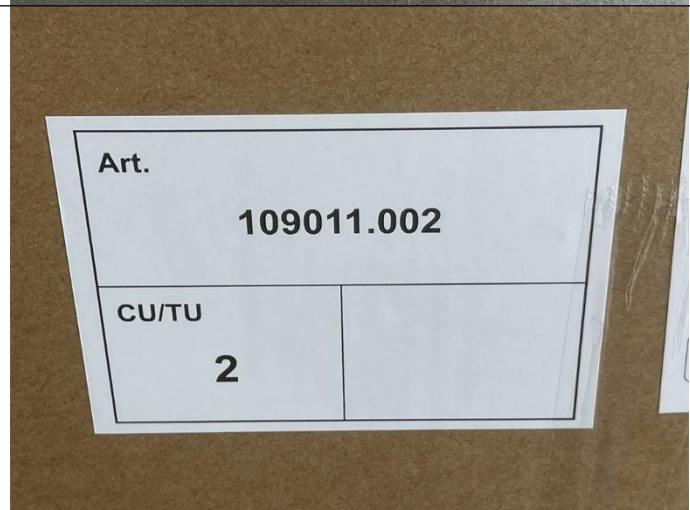


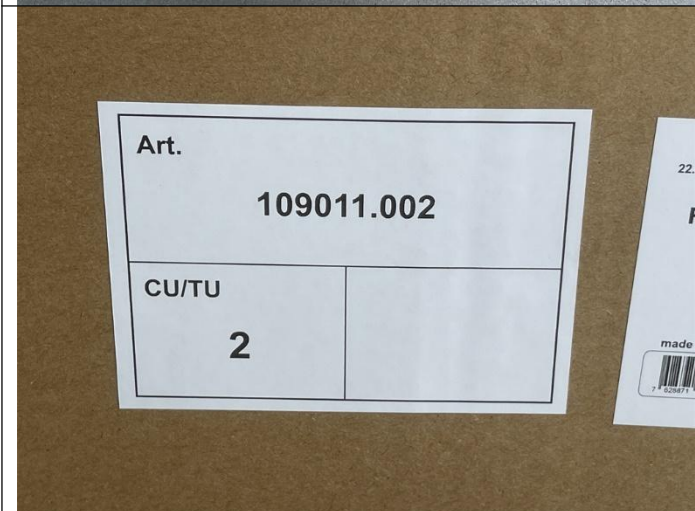


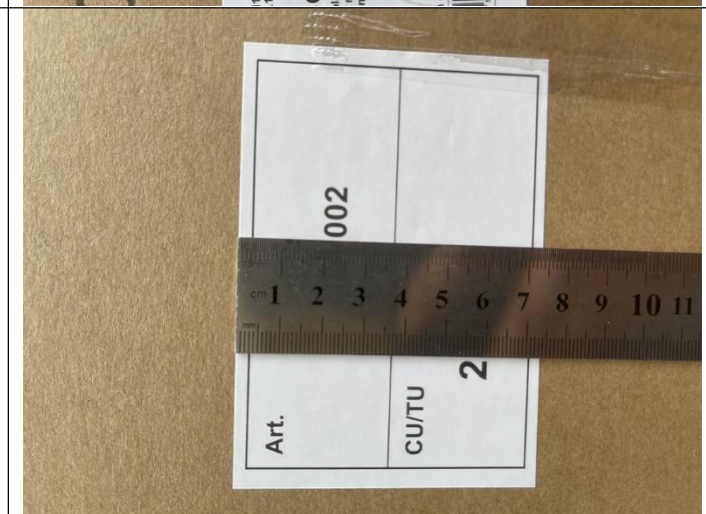

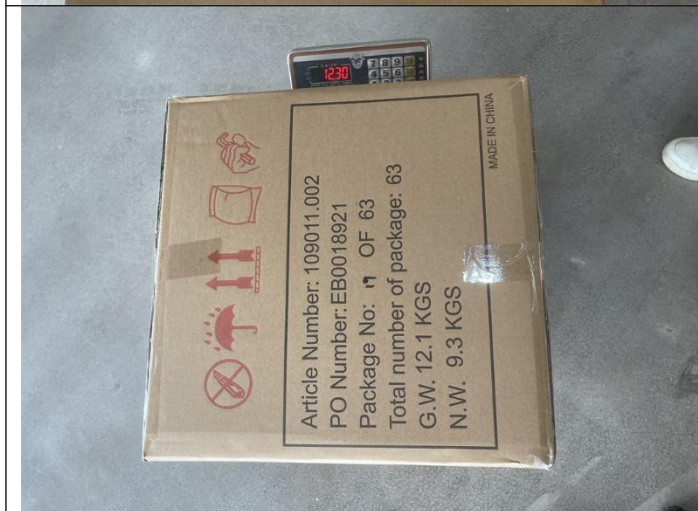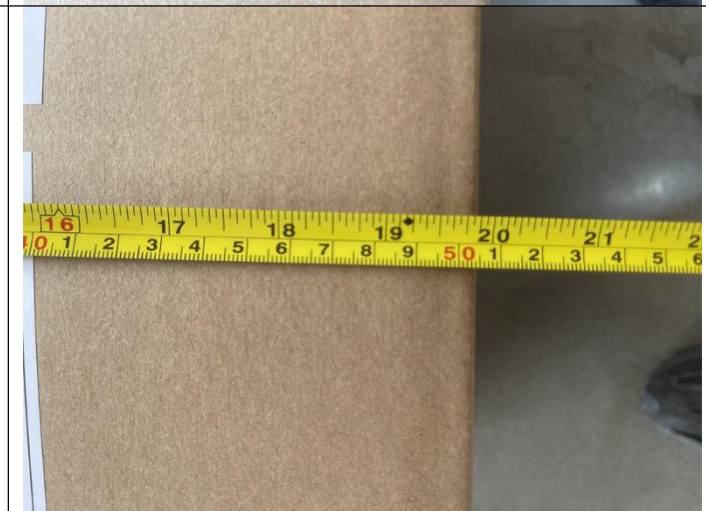



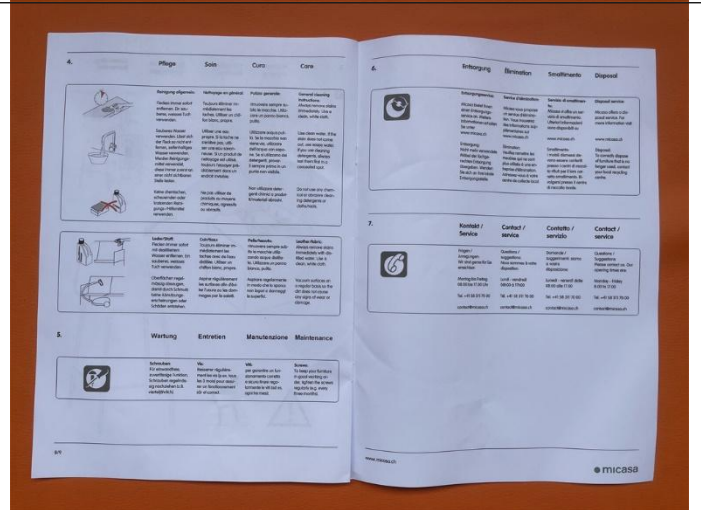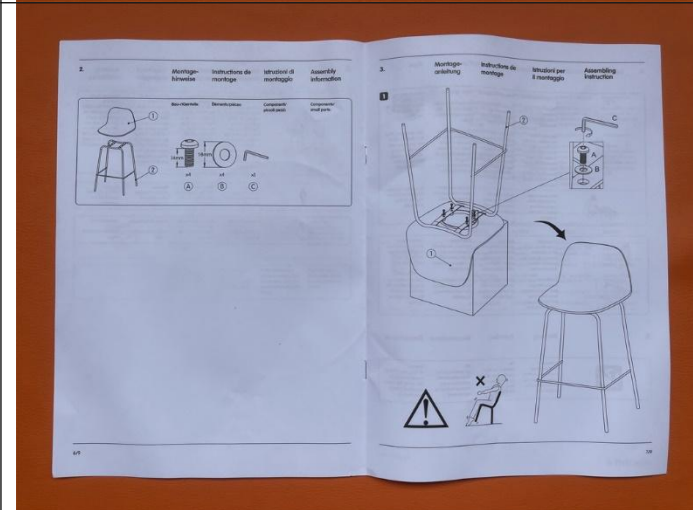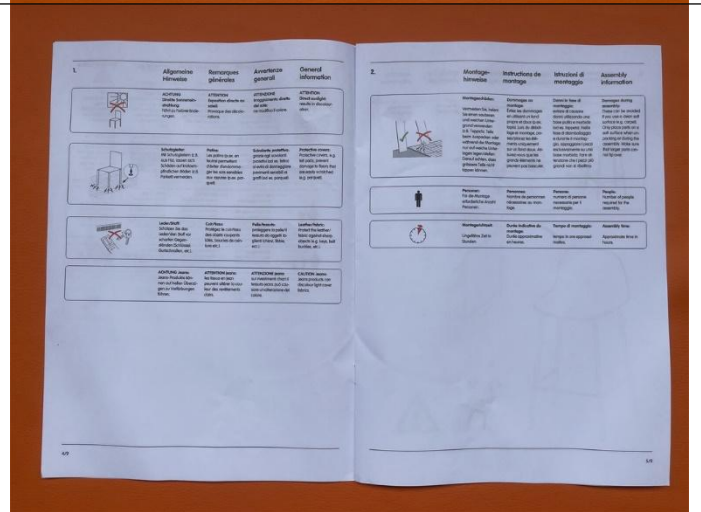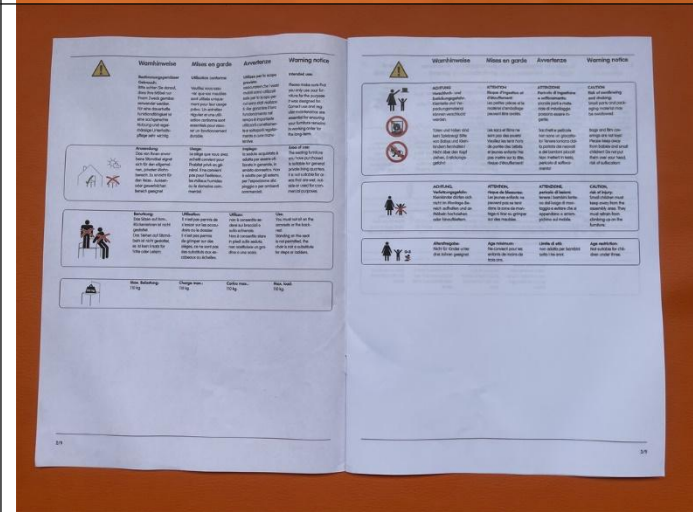

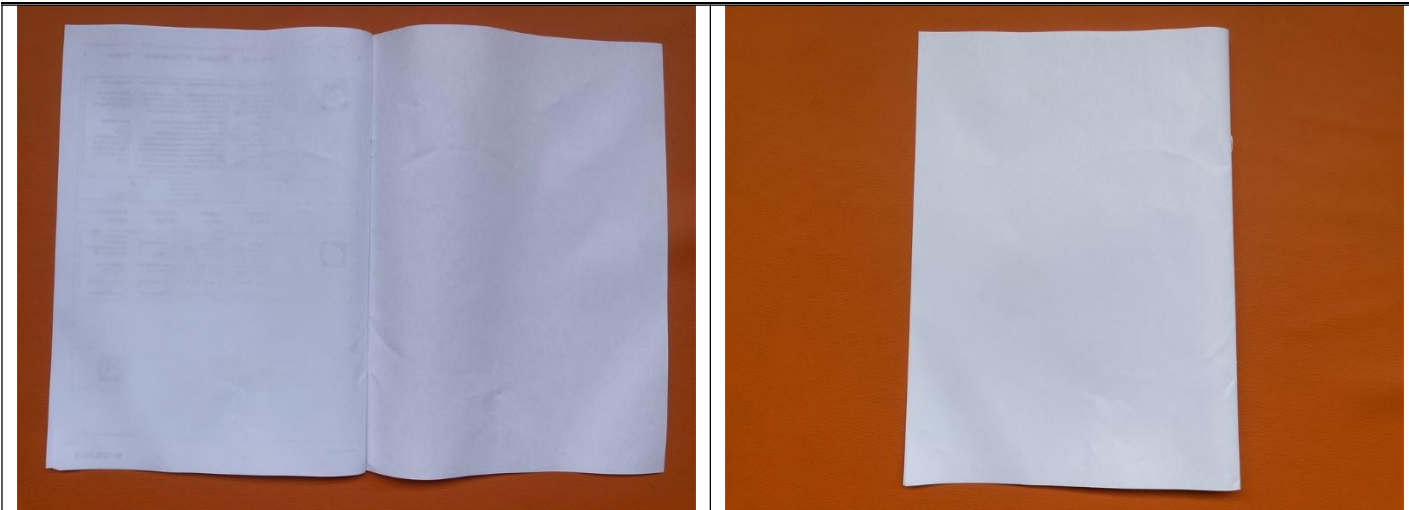











TESTS AND SPECIAL REQUIREMENTS

Requirements	Comments from Inspector	Result
Perform a carton drop test: 10 drops from the correct height based on carton weight as defined in ISTA 1 A(6 faces, 3 edges,1 corner) - On 1 cartons – packed products should not get damaged	Check OK	PASSED
		
		





		
<p>Perform a barcode-scanning test-The barcode should be scannable and have the correct number; make sure that that the correct barcode is on the correct product. (no mixed barcode for each reference)--S2(5pcs)</p>	<p>Check OK</p>	<p>PASSED</p>
		
		



Perform a rub test and an adhesive test-Perform the rub and adhesive test on all of printing, marking and logo found on the product: Use alcohol if petroleum spirits is not available for rub test; Use 3M tape for the adhesive test on the silk-screening and painting. -S2(5pcs)

Check OK

PASSED

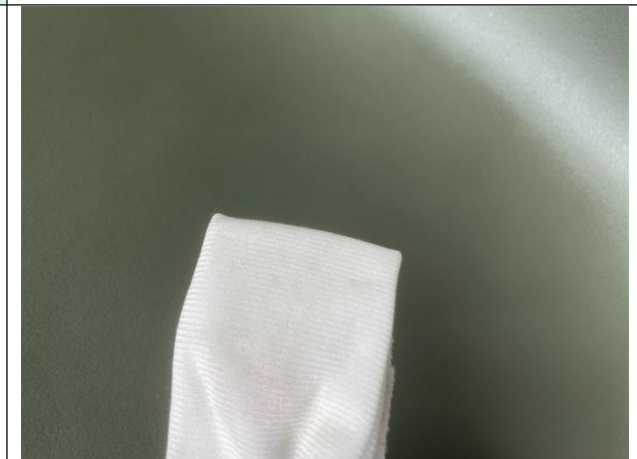






		
<p>Check the smell of product, is there any odor smell or bad smell?</p>	<p>Normal smell</p>	<p>PASSED</p>
		
	<p>/</p>	
<p>please check the surface details and stability</p>	<p>Check OK</p>	<p>PASSED</p>





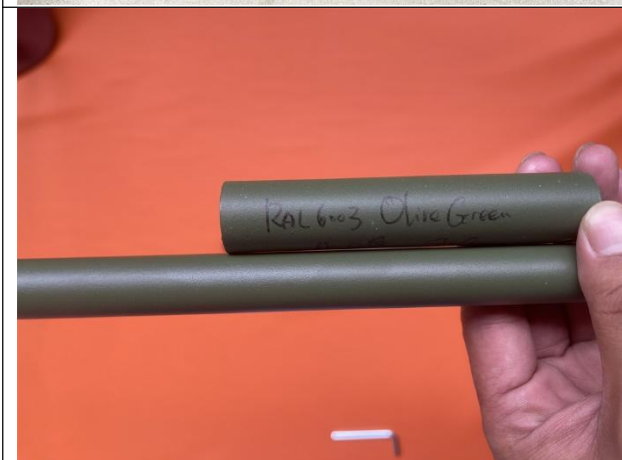

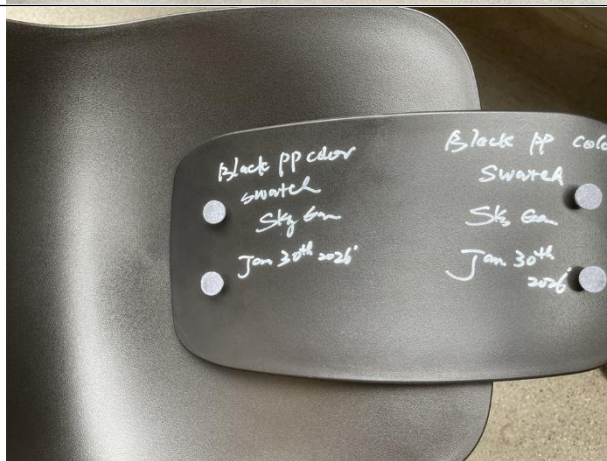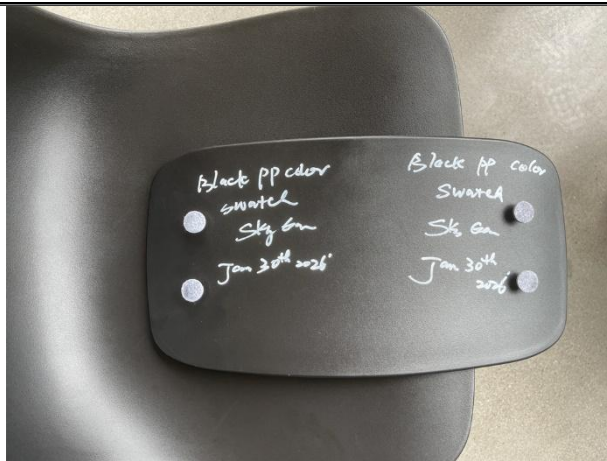

	<p>N/A</p>	
<p>Check and compare the color with color swatch</p>	<p>Check OK</p>	<p>PASSED</p>







<p>Assemble the item. Perform a function test and wobble check.-The item should be easy to assemble.--S2(5 Pcs)</p>	<p>Check OK</p>	<p>PASSED</p>
		
		
<p>xPerform a static loading test.x -Place 125kg on every seat of the item at the same time for 1 hour. Place the weights at least 10cm away from the edges of the seats - There should be no deformity.--S2(5pcs)</p>	<p>Check OK</p>	<p>PASSED</p>
		





<p>Perform a rub test and an adhesive test-Perform the rub and adhesive test on all of printing, marking and logo found on the product: Use alcohol if petroleum spirits is not available for rub test; Use 3M tape for the adhesive test on the silk-screening and painting. -S2(5pcs)</p>	<p>Check OK</p>	<p>PASSED</p>



DEFECTIVES LIST

	CRI	MAJ	MIN	Picture
Defects for style # 109010.002				
sub sample size :15pcs				
Scratch	0	0	1	-
Defects for style # 109011.002				
sub sample size :20pcs				



Scratch	0	0	1	-
				

Sample size	Maximum Allowed	Total Defectives	Result	Notes
CRI :	0	0	Within AQL	
MAJ :	3	0	Within AQL	
MIN :	5	2	Within AQL	

[End of the Report](#)