



Inspection Report (FRI)

IO#MT-20260429-001

GENERAL INFORMATION

Client: Zoe Furnconsult Ltd	
Product:	ARYA chair
Inspection location:	Huzhou Zhejiang
Inspection date:	2026/04/29
Your reference number:	109055.001
PO number:	POEB0017453
Supplier:	Actona Group A/S
Order quantity:	429 pcs
Qty ready for inspection (%):	429 pcs (100%)
Reference sample available:	Yes



INSPECTION RESULT

OVERALL RESULT	Pending				
CRITERIA	RESULTS		REMARKS		
1. Quantity	Confirm				
2. Production Status/specification	Confirm				
3. Packing and marking	Pending		2,3,4		
4. On-site tests & special requirement	Confirm		1		
5. WORKMANSHIP AQL:	Within AQL		CRI	MAJ	MIN
		Found	0	0	4
		Max	0	3	5
		Checked	50	50	50

REMARKS

1. The factory provides a reference sample of different colors, which only compares the styles of the products. At the same time, the factory provided a color swatch (fabric and wooden board), and after comparison, the actual color is consistent with the color swatch.



2.No CU label on product



N/A


3. No TU label on carton.



	109055.001	
CU/ TU 1	ARYA stuhl ARYA chaise ARYA sedia	



4. There are 15 sets of accessories(1 carton) on site, but no PO number and QTY information on shipping mark of carton.

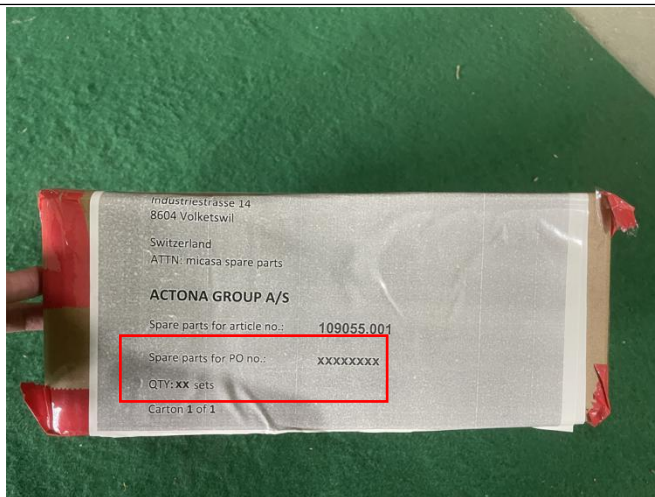



INSPECTION STANDARDS	
Inspection type	Final Random Inspection (FRI)
Sampling standard	ANSI/ASQ Z1.4-2003 (Equivalent to ISO 2859-1 or MIL-STD-105E)
Sampling Plan (Single)	II
AQL for Critical/ Major/ Minor	Not Allowed/2.5/4.0
Sampling size for Cri/Maj/Min	50/50/50
No. of cartons selected and inspected	50 cartons
Number list of selected cartons/packages	109055.001:394,119,248,72,414,38,213,157,301,8 8,264,165,341,55,407,186,130,227,290,45,376,199 ,102,350,82,426,313,173,255,96,367,143,209,328, 46,381,118,272,307,61,24,412,160,292,335,8,195, 378,113,247

1. Quantity	Result	Actual Finding / Comments
80%of the total order quantity must be packed. and 100% finished - order qty:	OK	All packed

Item/PO #	Order qty	Finished qty	Unfinished qty	Packed qty	Unpacked qty	Sample size
109055.001	429	429	0	429	0	50
Total:	429	429	0	429	0	50

Pictures:



2.Product Status:	Result	Problem Comments
		OK
2A. Product colour/design/specification		Actual Finding
Client's expected:		See below photos






Item No.	Spec./ref. sample	Sample 1	Sample 2	Sample 3
109055.001				
Size (cm)	54*56*76	54*56*76	54*56*76	54*56*76
Net weight (Kg)	6.7	6.7	6.7	6.7

Pictures:

Item: 109055.001




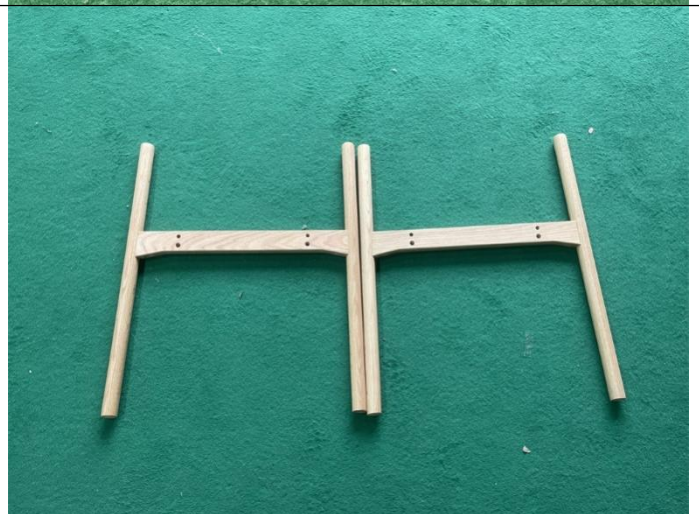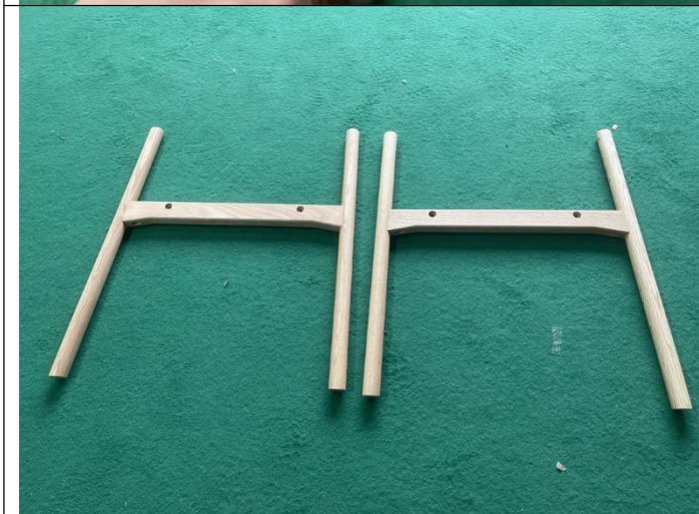

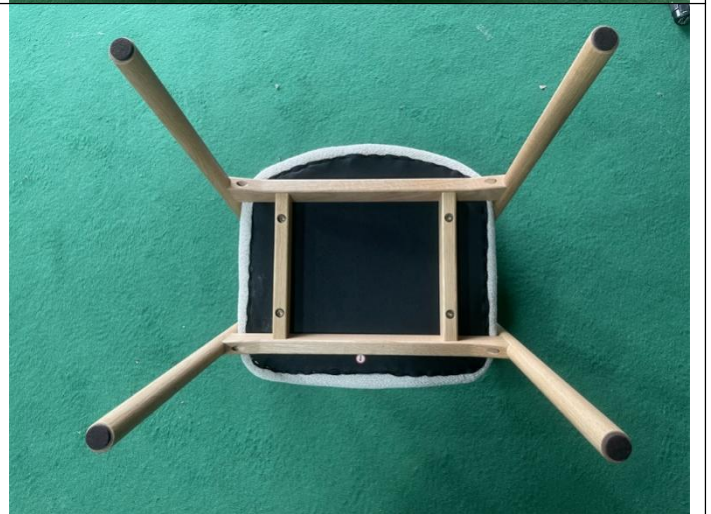





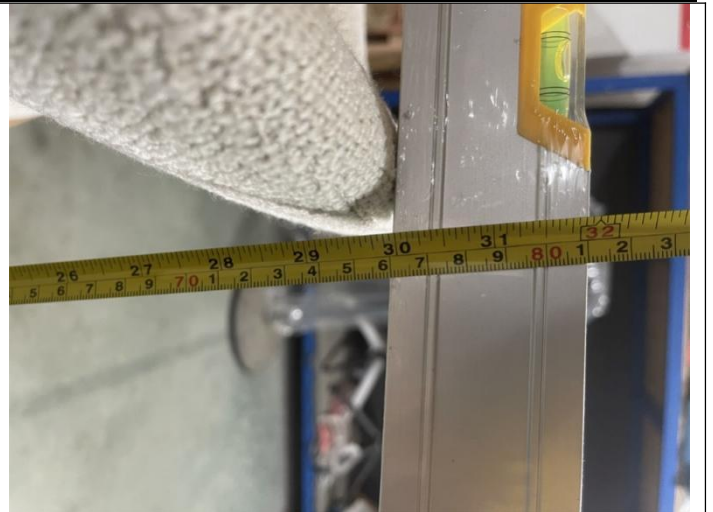



zofurnconsult.com




3. Packing and Marking	Result	Problem Comments
		Pending
3A. Shipping Marks/carton weight		Actual Finding
A1. Carton Mark		See below photos
A2. Weight of carton:		109055.001: 7.8kg
3B. Packing and dimension		Actual Finding
Client's comments:		
B1. Outer packing method and dimension L: cm x W: cm x H: cm		109055.001: 1pc/carton-75*59*14.5cm


Pictures:



Item: 10033819








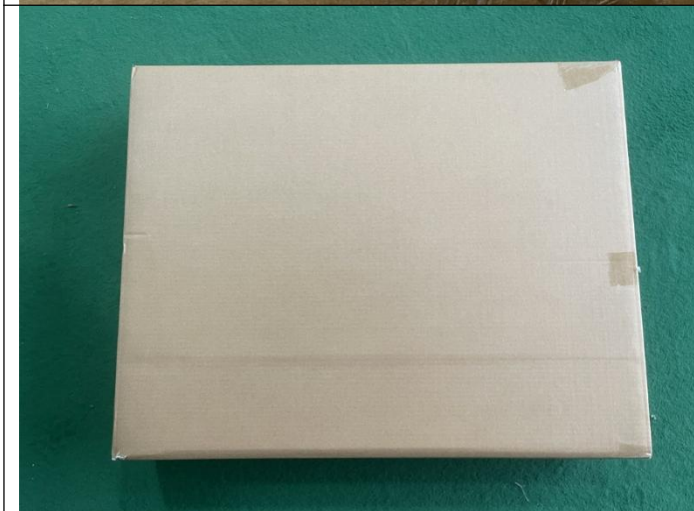

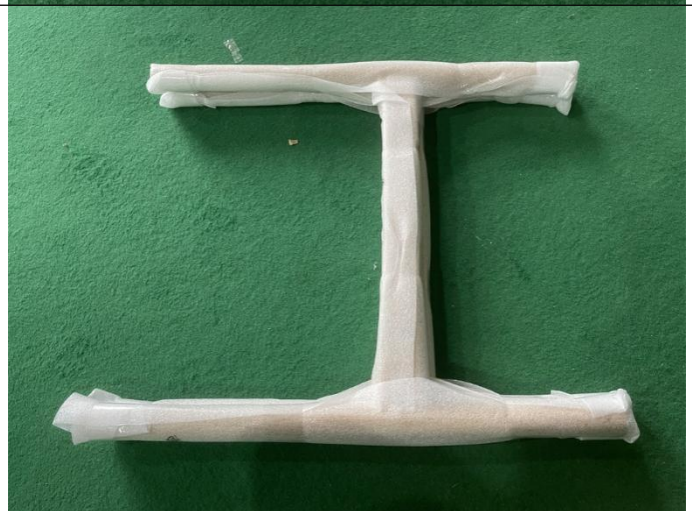

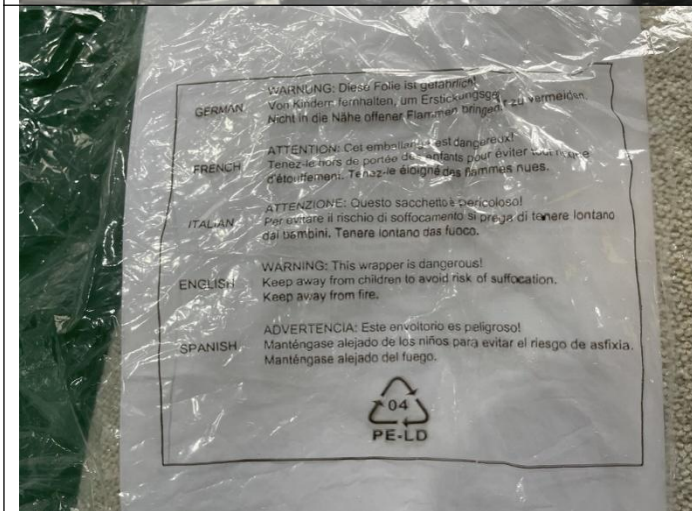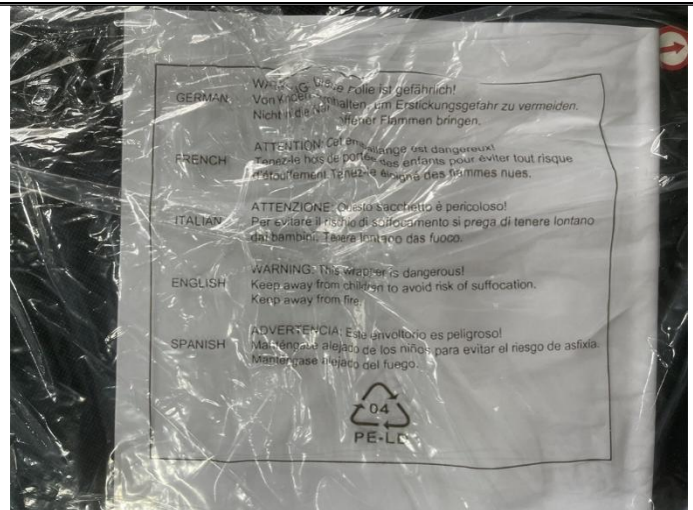


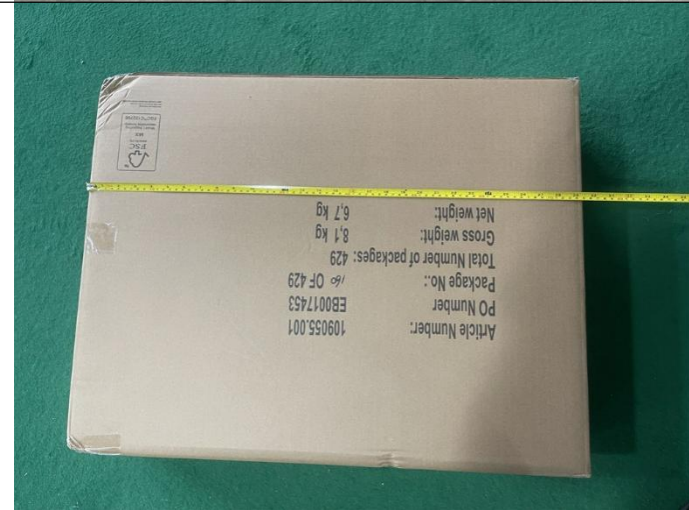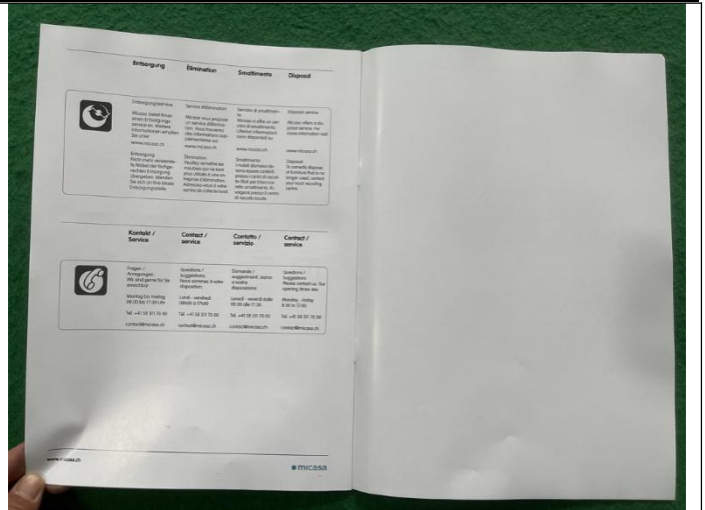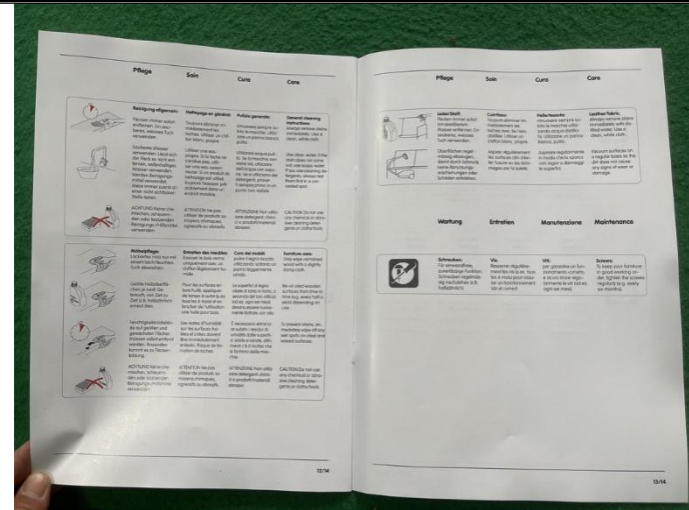





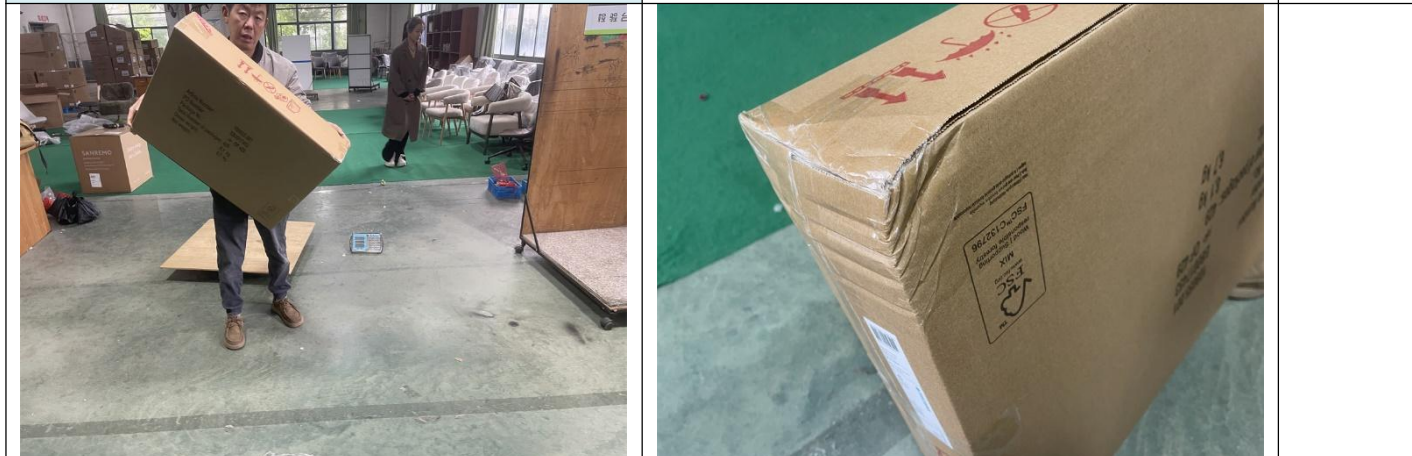

TESTS AND SPECIAL REQUIREMENTS





Requirements	Comments from Inspector	Result
Perform a carton drop test: 10 drops from the correct height based on carton weight as defined in ISTA 1 A(6 faces, 3 edges,1 corner) - On 1 cartons – packed products should not get damaged	Check OK	PASSED





<p>Perform a barcode-scanning test-The barcode should be scannable and have the correct number; make sure that that the correct barcode is on the correct product. (no mixed barcode for each reference)-S2</p>	<p>Check OK</p>	
		<p>PASSED</p>
<p>Perform a rub test and an adhesive test-Perform the rub and adhesive test on all of printing, marking and logo found on the product: Use alcohol if petroleum spirits is not available for rub test; Use 3M tape for the adhesive test on the silk-screening and painting. -S2</p>	<p>Check OK</p>	<p>PASSED</p>
		
<p>Check the smell of product, is there any odor smell or bad smell?</p>	<p>Normal smell</p>	<p>PASSED</p>



	<p>N/A</p>	
<p>please check the surface details and stability</p>	<p>Check OK</p>	<p>PASSED</p>
	<p>N/A</p>	
<p>check and compare the color with color swatch</p>	<p>The factory provides a reference sample of different colors, which only compares the styles of the products. At the same time, the factory provided a color swatch (fabric and wooden board), and after comparison, the actual color is consistent with the color swatch.</p>	<p>PASSED</p>
		



<p>Assemble the item. Perform a function test and wobble check.-The item should be easy to assemble.-S1(S-2 Pcs)</p>	<p>Check OK</p>	<p>PASSED</p>
<p>*Perform a static loading test.* -Place 125kg on every seat of the item at the same time for 1 hour. Place the weights at least 10cm away from the edges of the seats - There should be no deformity.-S-2 pcs</p>	<p>Check OK</p>	<p>PASSED</p>



Perform a fatigue test-On all adjustable parts. Do this 20 times.-S2

Check OK

PASSED




Humidity test-Testing the humidity of the wooden structure-S2

Check OK

PASSED



SPARE PARTS:

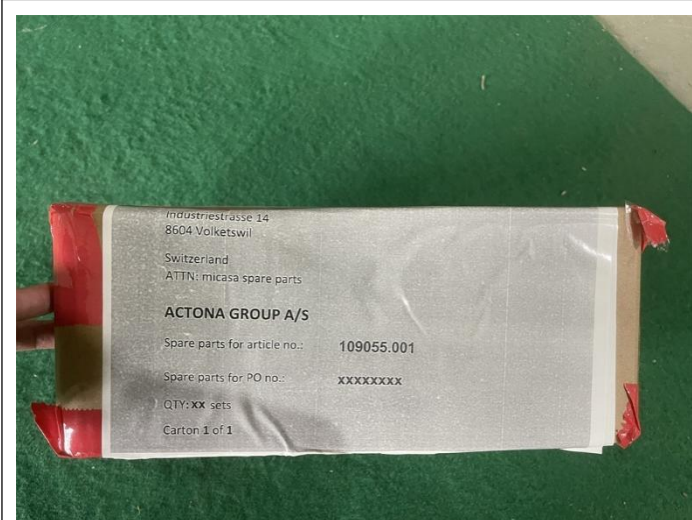



DEFECTIVES LIST				
	CRI	MAJ	MIN	Picture
Defects for style # 109055.001				
sub sample size :50pcs				
Untrimmed threads	0	0	2	-
<div style="display: flex; justify-content: space-between;">   </div>				



Corrugation

0

0

1



Exposed filling material

0

0

1





Sample size	Maximum Allowed	Total Defectives	Result	Notes
CRI :	0	0	Within AQL	
MAJ :	3	0	Within AQL	
MIN :	5	4	Within AQL	

End of the Report