

**GENERAL SUMMARY:**

Client:	-	
PO No.:	-	
Item No.:	3-in-1 Jar Opener Set	
Product Name:	3-in-1 Jar Opener Set	
Quantity:	500sets	
Inspection location:	Yangjiang, Guangdong, China	
Supplier:	Yangjiang Sun Well Industries Co.,Ltd	
Date of inspection:	May 13 2026	

OVERALL CONCLUSION:

Inspection criteria	Passed	Failed	Pending	Comments
Quantity available:	-	-	×	Remark 1
Product Conformity:	×	-	-	-
Workmanship:	×	-	-	-
Test and measurement:	-	-	×	Remark 4
Labeling:	-	-	×	Remark 2
Packing and shipping mark:	-	-	×	Remark 2,3
Result:	[] Acceptable		[] Reject	[x] Pending

SPECIAL REMARK:

1. Upon the arrival, Only 1 cartons have been packed, The rest of the products are still unpacked.
2. No shipping mark and labels spec. available for comparison on site.
3. No packing method spec. available for comparison on site.
- 4.The factory refused to conduct the product drop test.

AVAILABLE QUANTITY:

Order No.	Item No.	Order Qty		Packed		Not finished		Not packed		Inspect Qty	
		pcs	ctn	pcs	ctn	pcs	ctn	pcs	ctn	pcs	ctn
-	3-in-1 Jar Opener Set	500	10	50	1	0	0	450	9	50	1
Total:		500	10	50	1	0	0	450	9	50	1



Lot Size	General Inspection Levels			Special Inspection Levels			
	I	II	III	S1	S2	S3	S4
2 to 8	A	A	B	A	A	A	A
9 to 15	A	B	C	A	A	A	A
16 to 25	B	C	D	A	A	B	B
26 to 50	C	D	E	A	B	B	C
51 to 90	C	E	F	B	B	C	C
91 to 150	D	F	G	B	B	C	D
151 to 280	E	G	H	B	C	D	E
281 to 500	F	H	J	B	C	D	E
501 to 1,200	G	J	K	C	C	E	F
1,201 to 3,200	H	K	L	C	D	E	G
3,201 to 10,000	J	L	M	C	D	F	G
10,001 to 35,000	K	M	N	C	D	F	H
35,001 to 150,000	L	N	P	D	E	G	J
150,001 to 500,000	M	P	Q	D	E	G	J
500,001 and over	N	Q	R	D	E	H	K

Single sampling plans for normal inspection

Sample Size Code Letter	Sample Size	Acceptable Quality Levels (Normal Inspection)																					
		0.065		0.10		0.15		0.25		0.40		0.65		1.0		1.5		2.5		4.0		6.5	
		Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re
A	2																					0	1
B	3																					0	1
C	5																					0	1
D	8																					0	1
E	13																					1	2
F	20																					2	3
G	32																					3	4
H	50																					5	6
J	80																					7	8
K	125																					10	11
L	200																					14	15
M	315																					21	22
N	500																						
P	800																						
Q	1250																						
R	2000																						

Inspection standard: ANSI/ASQC Z1.4-2003 Sampling plan: <i>Single, Normal</i> Inspection level: II AQL: Critical: Not Allowed.	Sample Size: 50sets			
	Critical	Major	Minor	
	AQL:	0	2.5	4.0
	Defects Found:	0	1	4
Max. Allowed:	0	3	5	

WORKMANSHIP:



Item No.	Sample size	Defective rate	Defects Description	Cri	Maj	Min
3-in-1 Jar Opener Set	50sets	2%	Poor assembly	0	1	0
		4%	Scratched mark	0	0	2
		4%	Excessive flash	0	0	2
Total defect:				0	1	4
Allowed:				0	3	5
Result:				Pass		

Defect Pictures:



Poor assembly -Major



Scratched mark -Minor



Scratched mark -Minor



Excessive flash -Minor



	<p>N/A</p>
<p>Excessive flash -Minor</p>	

PRODUCT CONFORMITY & ON-SITE TESTS															
Check Points & On-site Tests	Sample Size	Criteria	Result & Remarks												
Visual Check (Style, Appearance, Material, Color)	All Sample size	a. Conformance to Style / Appearance / Material / Color compared against: <input checked="" type="checkbox"/> Client's / <input type="checkbox"/> Factory's ref. sample. <input type="checkbox"/> No ref. sample for comparison. (N.B.: Provide details in comment section if 2 or more color shades and/or any color variation is found.) b. Free of nick, burrs, pits, sharp point or any other defects which may affect the product serviceability. c. Finish/ coating is smooth and even without streaks, blisters, wrinkles, or runs. d. Good overall appearance with good alignment of components.	PASS												
Silk Screen Printing Adhesive Test	S-2	Stuck the 3M tape on the printing area and stayed for 30 seconds then torn off to see printing quality.	PASS												
Rubbing Test on Painting logo	S-2	Wet rubbing by water for 15 seconds and then dried as per client's specification.	PASS												
Barcode/QR code scanning test	S-2	Checked by scanner readable	PASS												
Export Carton Drop Test	1 Carton	Drop the carton for 10 times in the sequence of 1 corner, 3 edges and 6 faces with below criteria: <table border="1" style="width: 100%; border-collapse: collapse;"> <thead> <tr> <th>Carton Gross Wt. (kg)</th> <th>Drop Height (cm)</th> </tr> </thead> <tbody> <tr> <td>0.5 kg – 9.5 kg</td> <td>76cm</td> </tr> <tr> <td>≥ 9.5 kg – 18.6 g</td> <td>61cm</td> </tr> <tr> <td>≥ 18.6 kg – 27.7 kg</td> <td>46cm</td> </tr> <tr> <td>≥ 27.7 kg – 45.4 kg</td> <td>31cm</td> </tr> <tr> <td>45.4 kg – 68 kg</td> <td>20cm</td> </tr> </tbody> </table>	Carton Gross Wt. (kg)	Drop Height (cm)	0.5 kg – 9.5 kg	76cm	≥ 9.5 kg – 18.6 g	61cm	≥ 18.6 kg – 27.7 kg	46cm	≥ 27.7 kg – 45.4 kg	31cm	45.4 kg – 68 kg	20cm	PENDING Remarks :4
Carton Gross Wt. (kg)	Drop Height (cm)														
0.5 kg – 9.5 kg	76cm														
≥ 9.5 kg – 18.6 g	61cm														
≥ 18.6 kg – 27.7 kg	46cm														
≥ 27.7 kg – 45.4 kg	31cm														
45.4 kg – 68 kg	20cm														
Function check	S-2	All captioned function is well conducted as intended. Such as installation/adjusting, actual using function etc. All of function should be complied with claims.	PASS												
Product dimension	3pcs	Measure the dimensions of the product using a tape measure, Compared with the specifications,	PASS												



		the actual measurement error should be within the specified range.	
Hanging test	3 pcs		PASS

PACKING AND ACCESSORIES:

Item No.:	Master shipper (sets/ctn)	Carton size L×W×H (cm)	G.W (Kg)	N.W (Kg)	Color box size L×W×H (cm)	Color box weight(g)	Carton Barcode	Color box Barcode
3-in-1 Jar Opener Set	50	56*31*75	16.75	-	26.5x14.5x5.7	312.9	FBA199QMSY B8U000001	X0051YK6GJ

PRODUCT SPECIFICATION:

Item No.:	Check point	Client Spec.	Ref. Sample	Sample 1#	Sample 2#	Sample 3 #
3-in-1 Jar Opener Set	Size check(cm)	26.5x14.8x5	26.5x15x5	26.5x15x5	26.5x15x5	26.5x15x5
	Weight check(g)	210g	225.3g	225.5g	224.5g	226.2g

EXPORT CARTON INFORMATION:

Carton:	New export carton	Yes	Sealing:	Opaque gummed tape	-
Fastening:	Metal staples	No		Transparent gummed tape	Yes
Strapping:	Nylonx2	No		Paper tape	-
Material:	Ply of corrugated paper	5 Ply	Others:	-	

Product photo show:





FBA sticker



Open carton view



Open carton view



Open carton view



Open carton view



Open carton view



Color box view




Color box view



Color box view



Color box view

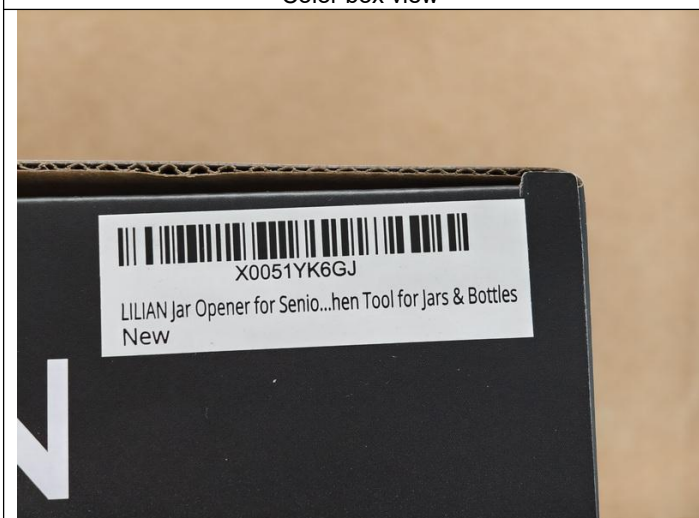

Color box view



Color box view




Color box view



Color box view



Color box view

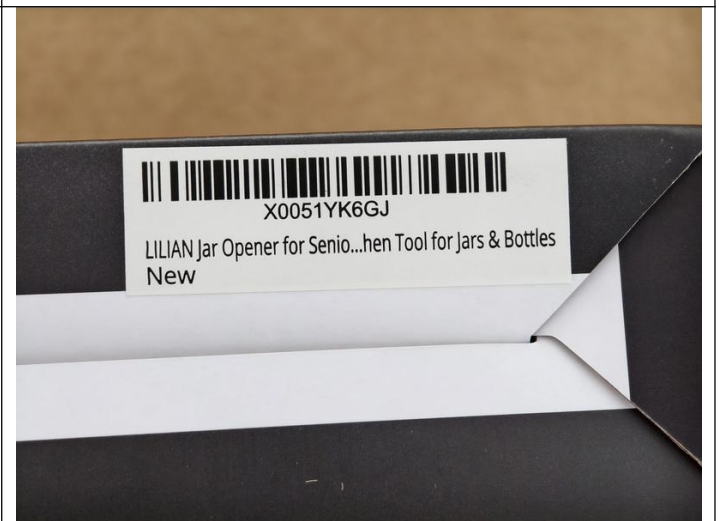

Color box view



Color box view



Open color box view



Open color box view



Open color box view




Open color box view



Product view



Product view

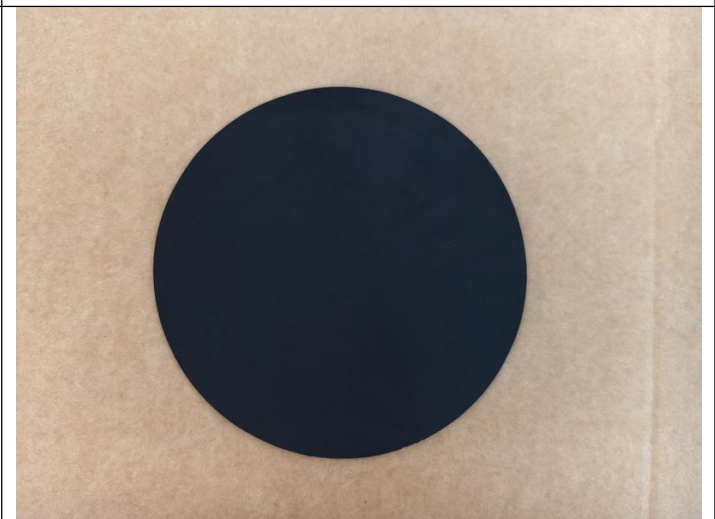

Product view



Product view



Product view



Product view



Product view



Product view



Product view



Product view



Product view



Product view



Product view



Product view



Product view



Product view



Product view



Product view



Product view



Product view

NA

Measurement and Test



Outer carton weight: 16.75kg



Outer carton weight: 16.75kg



Color box weight: 312.9g



Product weight: 190.8g



Set product weight: 225.3g



Outer carton size: 56*31*75cm



Outer carton size: 56*31*75cm




Outer carton size: 56*31*75cm



Outer carton size: 56*31*75cm




Outer carton size: 56*31*75cm

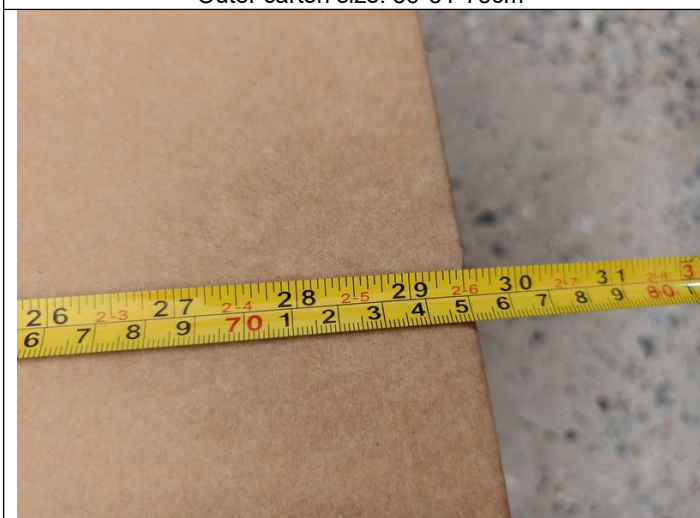

Outer carton size: 56*31*75cm



Color size: 26.5*5.7*14.5cm

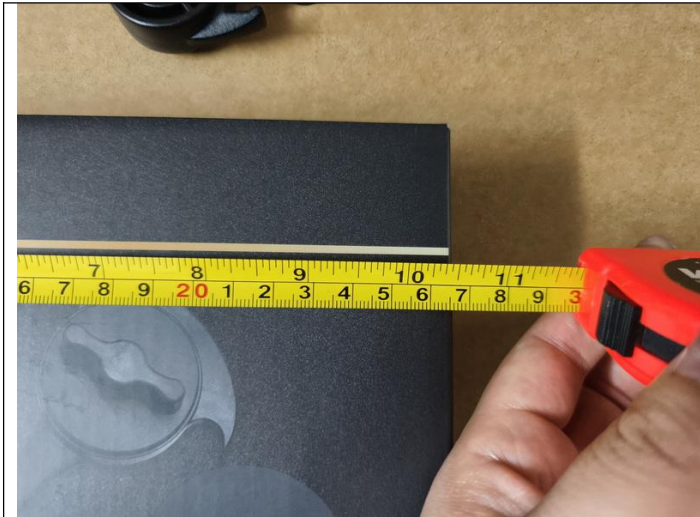


Color size: 26.5*5.7*14.5cm



Color size: 26.5*5.7*14.5cm



Color size: 26.5*5.7*14.5cm

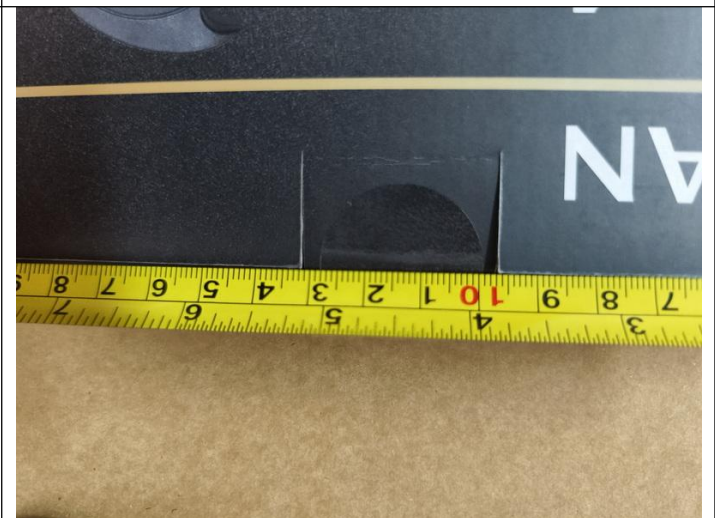

Round sticker:3cm



Logo size: 3*0.9cm



Logo size: 3*0.9cm



Rubber non-slip grip pad: 12.5cm




Product size: 26.5*15*5cm



Product size: 26.5*15*5cm



Product size: 26.5*15*5cm

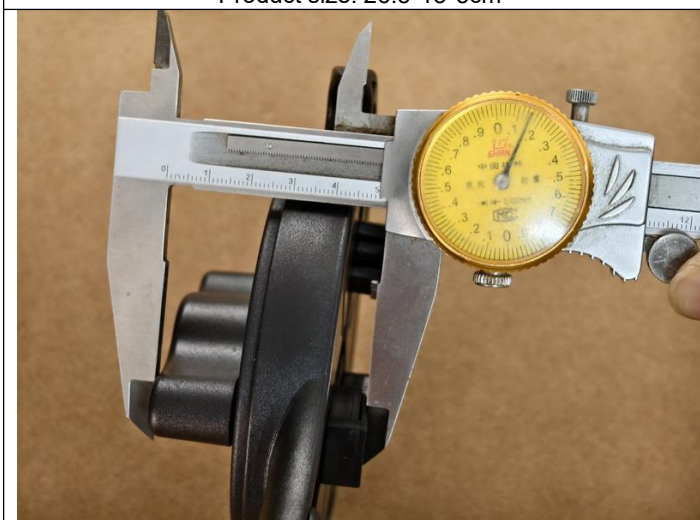


Product size: 26.5*15*5cm




Sample contrast




Sample contrast

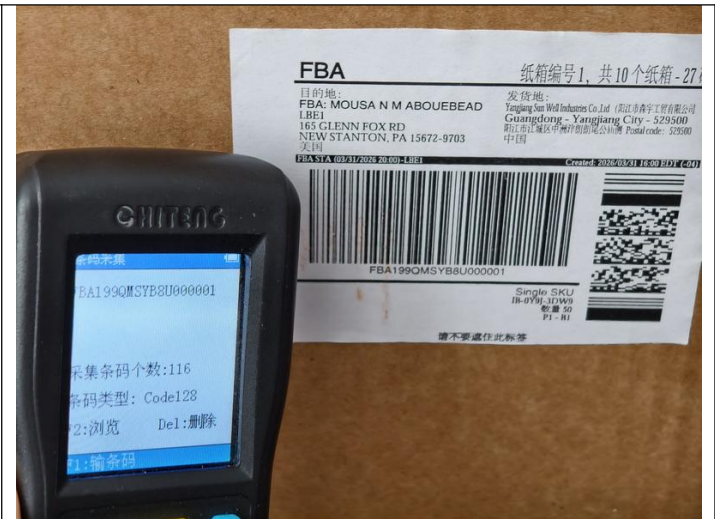

Bar code scan test

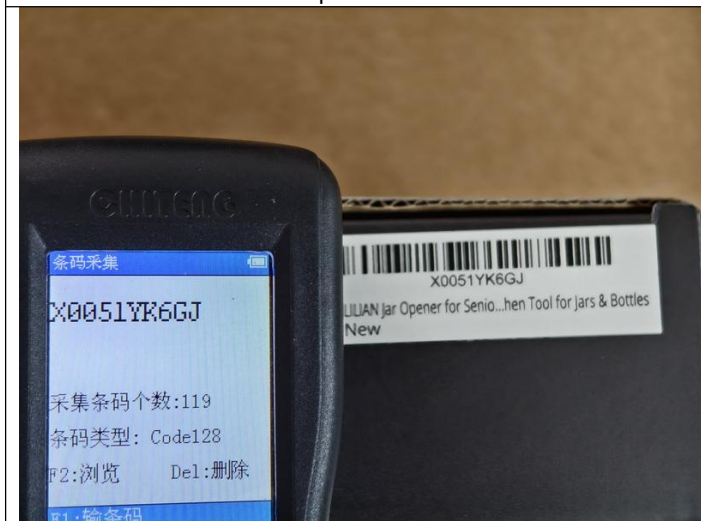

Bar code scan test

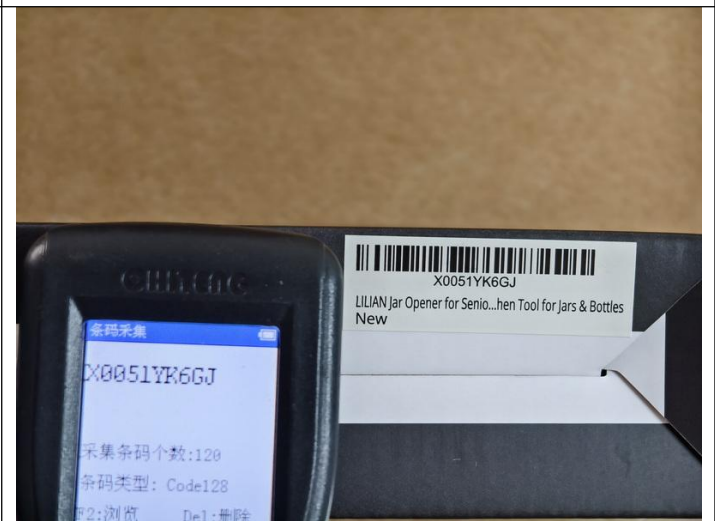

Bar code scan test



Hanging test



Hanging test




Rub test



3M tape test



3M tape test

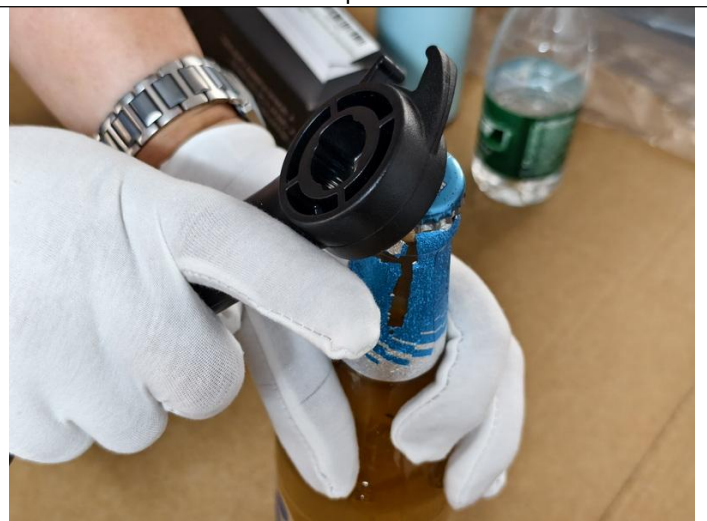

Function test



Function test



Function test




Function test



Function test



Function test

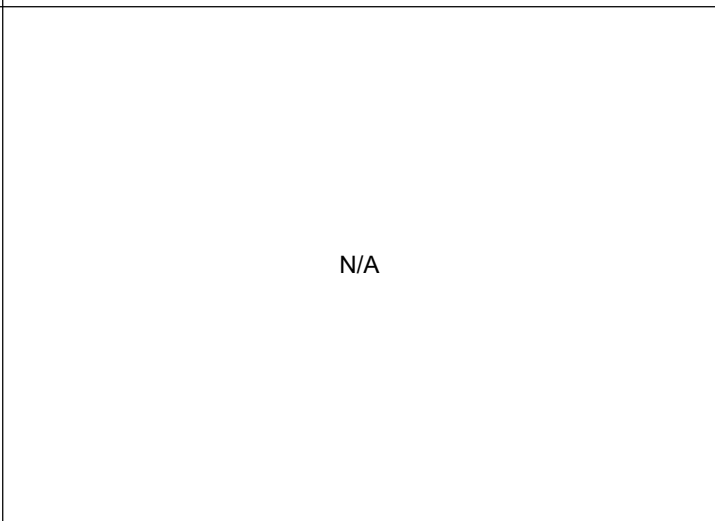

N/A

Other photos



Factory gate



Warehouse



Warehouse



Warehouse



Warehouse



Inspection site



Warehouse



Inspection site

--The End Of Report--