

**GENERAL SUMMARY:**

Client:	-	
Product Description:	85% BCI cotton 15% Recycled polyester Ottoman, 330gsm, 65/67", 10120 Moonbeam PANTONE 13-0000TCX	
Supplier:	-	
Contact person:	Lu Oanh	
Insp. Location:	Lot All-11, Tan Huong Industrial Park, Tan Huong Commune, Dong Thap Province	
Date of insp.:	Apr 13 th , 2026	
Inspector:	Mr.Quy	

Order No.	Style No.	Order Qty (Rolls)	Available Quantity(Rolls)			Inspect Qty(Rolls)			
			Packed	Not packed	Not finished				
/	2262091Chuck-10120 Moonbeam	122	122	0	0	6			
Total		122	122	0	0	6			
Inspection standard: Four point system Sampling plan: <i>Single, Normal</i> Inspection level: Fixed, 6 rolls						Sample Size: 6rolls			
							Critical	Major	Minor
						AQL:	Measure fabrics with GSM deviation greater than 10%		
						Defects Found:	-	-	-
						Max. Allowed:	-	-	-

Overall conclusion:

Inspection criteria	Passed	Failed	Pending	Comments
Quantity available:	-	-	-	No need
Workmanship:	-	-	-	No need
Test:	-	-	-	No need
Data measurement:	-	-	X	Actual findings
Labeling:	-	-	-	No need
Packing/markings:	-	-	-	No need
Result:	[] Acceptable [] Reject [x] Pending			

Special remark:

- There are 2 rolls (47, 20) already released to the sewing line; therefore, inspection cannot be conducted.
- The factory has declined to provide the order information, therefore, the inspector cannot find how many fabrics have been cut and how many pieces have been made into ready to wear by the factory

GSM check table

Lot Number	Roll number	Before Shrinkage(G/m ²)						After Shrinkage(G/m ²)					
		(GSM below 297 grams is marked in red)						(GSM below 314 grams is marked in red)					
260304075	29	291	296	296	291	296	296	302	307	306	306	302	307
260304075	18	298	305	304	304	298	305	305	312	299	299	305	312



Final Random Inspection Report

MT-INSPECTION


Report No.:MT-VN-20260413-001

260203026	47	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
260203026	20	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
260316026	17	285	291	289	293	286	290	308	295	299	306	291	312
260316026	16	299	290	303	289	292	308	311	296	306	302	307	296

PRODUCT PHOTO SHOW:

2226091Chuck- 10120 Moonbeam

LOT#260304075 Roll #29:

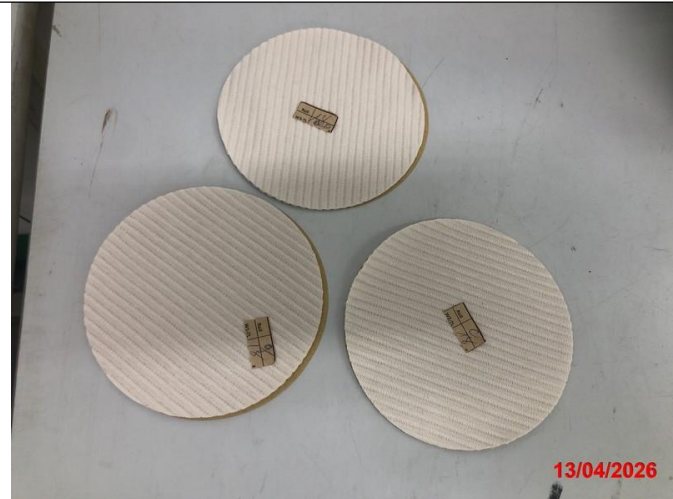


Samples



GSM check (Before Shrinkage)



GSM check (Before Shrinkage)

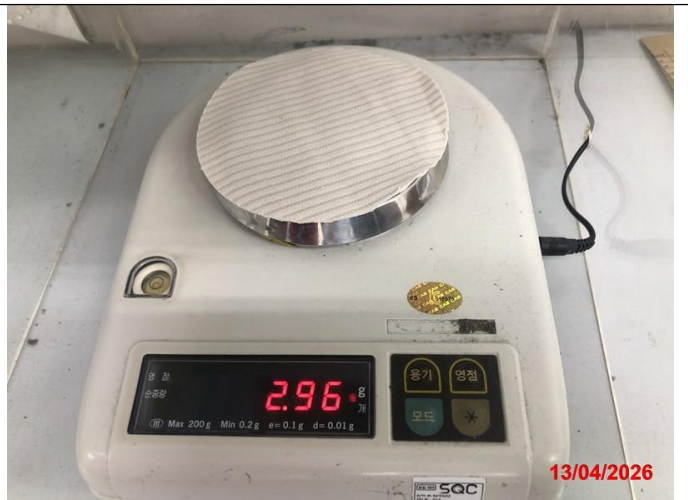

GSM check (Before Shrinkage)



GSM check (Before Shrinkage)



GSM check (Before Shrinkage)



Final Random Inspection Report



GSM check (Before Shrinkage)



GSM check (after Shrinkage)



GSM check (after Shrinkage)



GSM check (after Shrinkage)



GSM check (after Shrinkage)



GSM check (after Shrinkage)



Final Random Inspection Report

MT-INSPECTION

Report No.:MT-VN-20260413-001




N/A

GSM check (after Shrinkage)

NA

LOT#260304075 Roll #18:

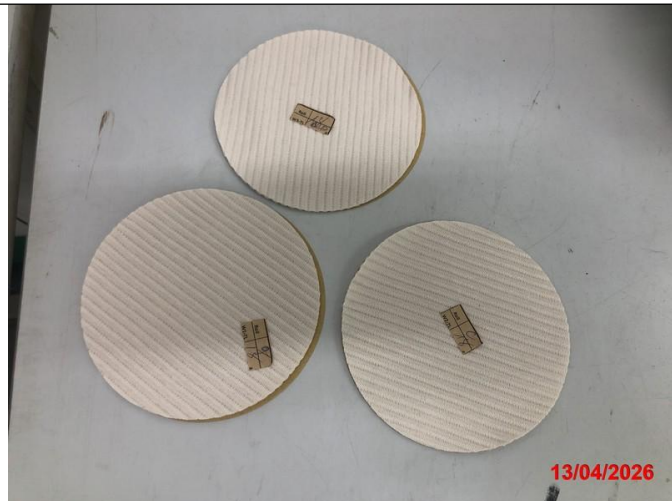

Samples

GSM check (Before Shrinkage)



GSM check (Before Shrinkage)

GSM check (Before Shrinkage)



Final Random Inspection Report



GSM check (Before Shrinkage)



GSM check (Before Shrinkage)



GSM check (Before Shrinkage)



GSM check (after Shrinkage)



GSM check (after Shrinkage)



GSM check (after Shrinkage)



MT-INSPECTION

Final Random Inspection Report

Report No.:MT-VN-20260413-001



GSM check (after Shrinkage)



GSM check (after Shrinkage)



GSM check (after Shrinkage)

N/A

LOT#260203026 Roll #47 + Roll#20



Cutting view



QC check view



MT-INSPECTION

Final Random Inspection Report

Report No.:MT-VN-20260413-001



QC check view



Ironing view



Product view



Product view



Product view



Product view



MT-INSPECTION

Final Random Inspection Report

Report No.:MT-VN-20260413-001



13/04/2026

Product view



13/04/2026

Product view



13/04/2026

Product view



13/04/2026

Product view

LOT#260316026 Roll #17:



13/04/2026

Label on roll



13/04/2026

GSM check (Before Shrinkage)



Final Random Inspection Report



GSM check (Before Shrinkage)



GSM check (Before Shrinkage)



GSM check (Before Shrinkage)



GSM check (Before Shrinkage)



GSM check (Before Shrinkage)



GSM check (after Shrinkage)



Final Random Inspection Report



13/04/2026

GSM check (after Shrinkage)



13/04/2026

GSM check (after Shrinkage)



13/04/2026

GSM check (after Shrinkage)



13/04/2026

GSM check (after Shrinkage)



13/04/2026

GSM check (after Shrinkage)

N/A

NA



Final Random Inspection Report



Label on roll



GSM check (Before Shrinkage)



GSM check (Before Shrinkage)



GSM check (Before Shrinkage)



GSM check (Before Shrinkage)



GSM check (Before Shrinkage)



Final Random Inspection Report



GSM check (Before Shrinkage)



GSM check (after Shrinkage)



GSM check (after Shrinkage)



GSM check (after Shrinkage)




GSM check (after Shrinkage)



GSM check (after Shrinkage)



GSM check (after Shrinkage)



N/A

NA

Other Photos



Factory gate



Factory gate



Rolls stack



Rolls stack

THE END