



Inspection Report (FRI)

IO#MT-20260420-001

GENERAL INFORMATION

Client: Zoe Furnconsult Ltd		
Product:	Storage ottoman	
Inspection location:	Huzhou Zhejiang	
Inspection date:	2026/04/20	
Your reference number:	117275.001	
PO number:	EB0017978	
Supplier:	HANGZHOU SASUN IMP AND EXP CO.,LTD	
Order quantity:	310 pcs	
Qty ready for inspection (%):	310 pcs (100%)	
Reference sample available:	Yes	

INSPECTION RESULT

OVERALL RESULT	PENDING				
CRITERIA	RESULTS	REMARKS			
1. Quantity	Confirm				
2. Production Status/specification	Confirm				
3. Packing and marking	Pending	2			
4. On-site tests & special requirement	Pending	1			
5. WORKMANSHIP AQL:	Within AQL		CRI	MAJ	MIN
		Found	0	1	3
		Max	0	3	5
		Checked	50	50	50

REMARKS

1. There was no sample signature at the site. There was only a color sample, which differed slightly from the product color. The factory informed us that this sample was from 2023.



2. The gross weight printed on the outer box is 7.6 kg, but the actual weight measured is 6.70/6.74/6.78 kg, which exceeds the 5% error range.

Article Number: 117275.001
Order Number: EB0017978
Package No: 102 OF 310
Total number of packages: 310
G.W.: 7.6 Kgs
N.W.: 5.8 Kgs





INSPECTION STANDARDS	
Inspection type	Final Random Inspection (FRI)
Sampling standard	ANSI/ASQ Z1.4-2003 (Equivalent to ISO 2859-1 or MIL-STD-105E)
Sampling Plan (Single)	II
AQL for Critical/ Major/ Minor	Not Allowed/2.5/4.0
Sampling size for Cri/Maj/Min	50/50/50
No. of cartons selected and inspected	50 cartons
Number list of selected cartons/packages	58/214/89/306/145/22/290/102/67/251/189/44/12 2/275/33/198/96/267/142/15/301/178/55/239/119/ 288/72/201/166/133/310/92/271/158/37/225/184/ 76/295/100/245/8/283/149/30/263/207/274/61

1. Quantity	Result	Actual Finding / Comments
80%of the total order quantity must be packed. and 100% finished - order qty:	OK	All packed

Item/PO #	Order qty	Finished qty	Unfinished qty	Packed qty	Unpacked qty	Sample size
117275.001	310	310	0	310	0	50
Total:	310	310	0	310	0	50

Pictures:



2.Product Status:	Result	Problem Comments
		OK
2A. Product colour/design/specification		Actual Finding
Client's expected:		See below photos



zoefurnconsult.com

Item No.	Spec./ref. sample	Sample 1	Sample 2	Sample 3
117275.001				
Size (cm)	D43*H47cm	D43*H47.5cm	D43*H47cm	D43*H47cm
Net weight (Kg)	5.8kg	5.72kg	5.73kg	5.75kg

Pictures:



Item: 117275.001









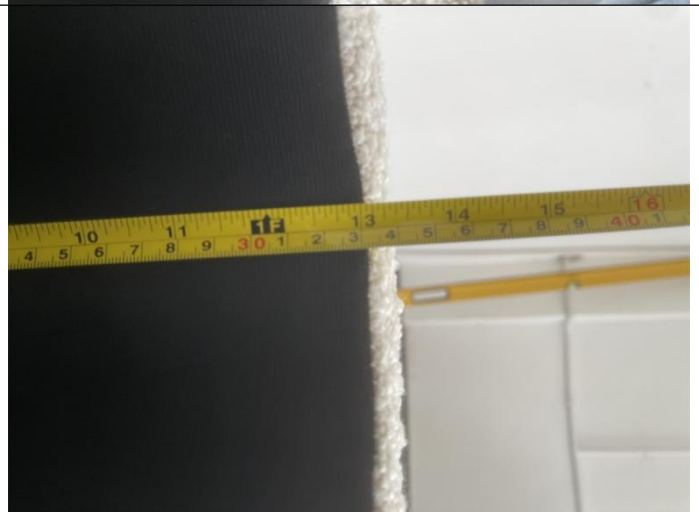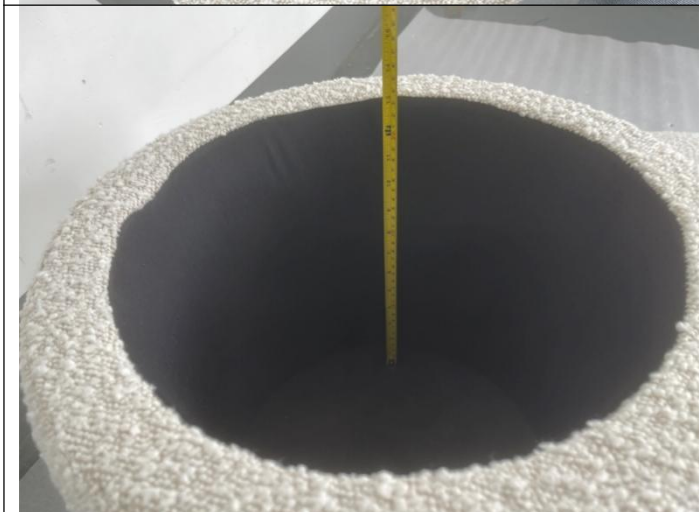






		Result	Problem Comments
3. Packing and Marking		Pending	Remark 2:The gross weight printed on the outer box is 7.6 kg, but the actual weight measured is 6.70/6.74/6.78 kg, which exceeds the 5% error range.
3A. Shipping Marks/carton weight		Actual Finding	
A1. Carton Mark		See below photos	
A2. Weight of carton:		117275.001: Spec.-7.6kg,Actual-6.7/6.74/6.78kg	
3B. Packing and dimension		Actual Finding	
Client's comments:			
B1. Outer packing method and dimension L: cm x W: cm x H: cm		117275.001:43*44*48cm	

Pictures:

Item: 117275.001



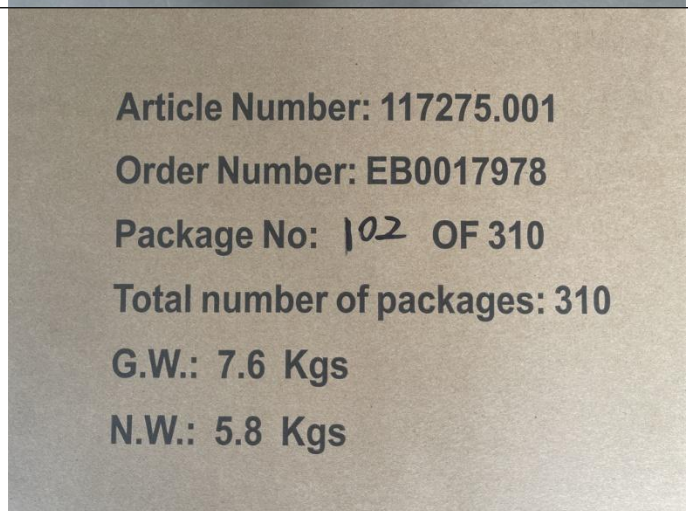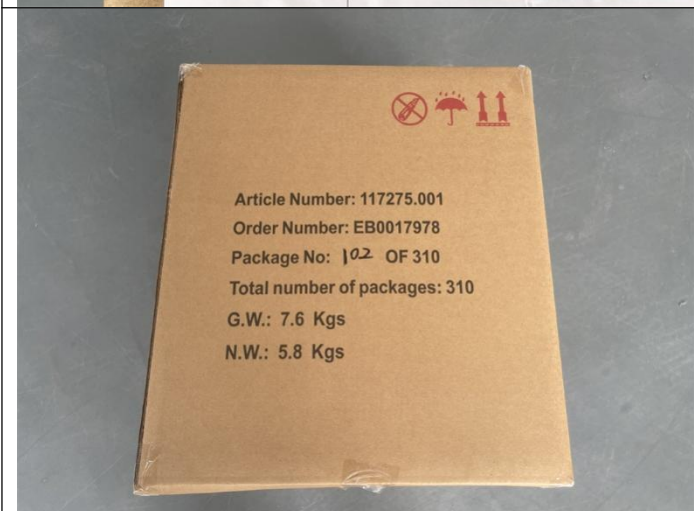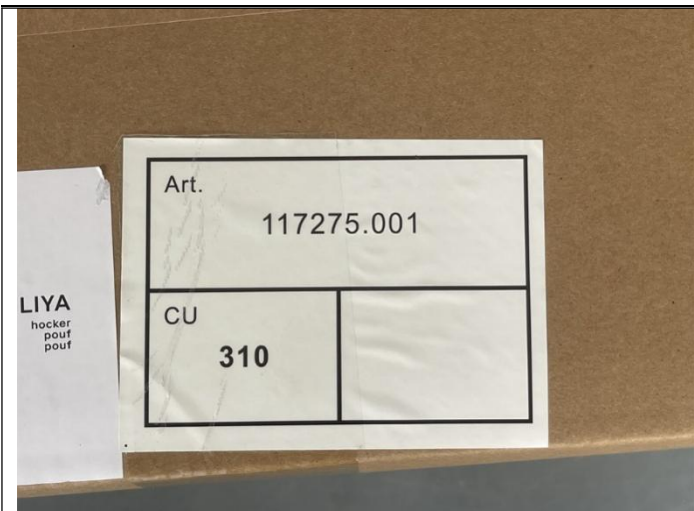











TESTS AND SPECIAL REQUIREMENTS


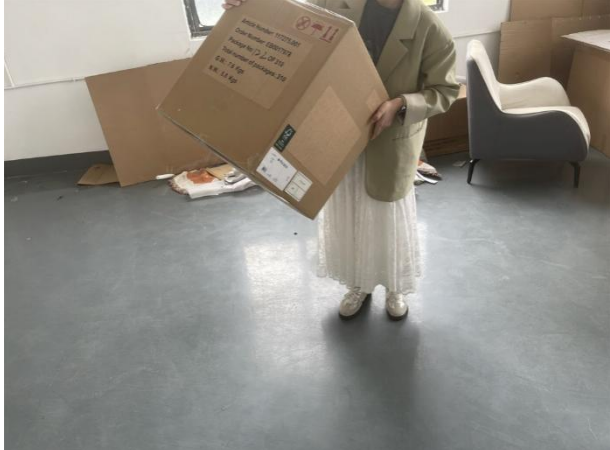
Requirements	Comments from Inspector	Result
<p>Perform a carton drop test: 10 drops from the correct height based on carton weight as defined in ISTA 1 A(6 faces, 3 edges,1 corner) - On 1 cartons – packed products should not get damaged</p>	Check OK	PASSED
		



Perform a barcode-scanning test-The barcode should be scannable and have the correct number; make sure that that the correct barcode is on the correct product. (no mixed barcode for each reference)-S2

Check OK

PASSED

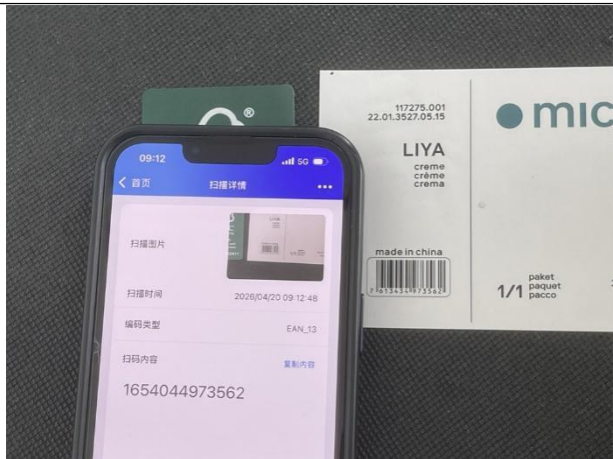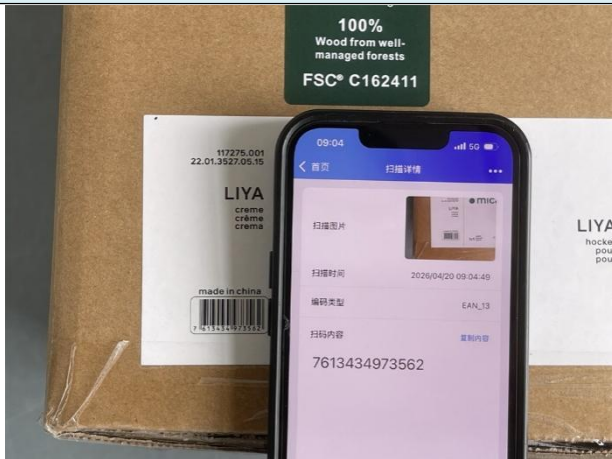

PASSED

Perform a rub test and an adhesive test-Perform the rub and adhesive test on all of printing, marking and logo found on the product: Use alcohol if petroleum spirits is not available for rub test; Use 3M tape for the adhesive test on the silk-screening and painting. -S2

Check OK

PASSED







Check the smell of product, is there any odor smell or bad smell?

Normal smell

PASSED



	<p style="text-align: center;">/</p>	
<p>please check the surface details and stability</p>	<p style="text-align: center;">Check OK</p>	<p style="text-align: center;">PASSED</p>
	<p style="text-align: center;">/</p>	
<p>check and compare the color with color swatch</p>	<p style="color: red;">There was no sample signature at the site. There was only a color sample, which differed slightly from the product color. The factory informed us that this sample was from 2023.</p>	<p style="text-align: center;">Pending</p>
		
<p>*Perform a static loading test.* -Place 125kg on every seat of the item at the same time for 1 hour. Place the weights at least 10cm away from the edges of the seats - There should be no deformity.-S-2 pcs</p>	<p style="text-align: center;">Check OK</p>	<p style="text-align: center;">PASSED</p>



Humidity test-Testing the humidity of the wooden structure-S2

Check

PASSED



DEFECTIVES LIST

	CRI	MAJ	MIN	Picture
--	------------	------------	------------	----------------

Defects for style # 117275.001
sub sample size :50pcs

Untrimmed threads	0	0	2	-
-------------------	---	---	---	---





Damaged

0

1

0




Material exposed

0

0

1

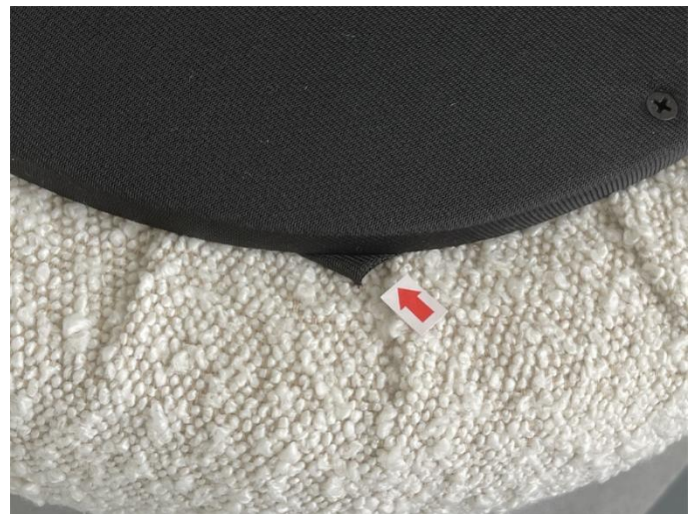



Sample size	Maximum Allowed	Total Defectives	Result	Notes
CRI :	0	0	Within AQL	
MAJ :	3	1	Within AQL	
MIN :	5	3	Within AQL	

End of the Report