




MT-INSPECTION

Final Random Inspection Report

Report No.: MT-20260507-001

GENERAL SUMMARY:

Client:	/	
PO No.:	/	
Item No.:	CC-140	
Product Name:	Trolley	
Quantity:	460pcs	
Inspection location:	JinYun, ZheJiang, China	
Supplier:	Zhejiang Ranbo Electric Appliance Co., Ltd	
Date of inspection:	May 7, 2026	

OVERALL CONCLUSION:

Inspection criteria	Passed	Failed	Pending	Comments
Quantity available:	x	-	-	Remark 1
Product Conformity:	-	-	x	Remark 2
Workmanship:	-	-	x	Remark 4
Test and measurement:	-	-	x	Remark 4
Labeling:	x	-	-	-
Packing and shipping mark:	-	-	x	Remark 3
Result:	<input type="checkbox"/> Acceptable <input type="checkbox"/> Reject <input checked="" type="checkbox"/> Pending			

SPECIAL REMARK:

1. Upon the arrival, all products were finished and all packed into cartons.
2. There's no approved sample providing for reference during inspection.
3. No packing method spec. available for comparison on site.
4. Selected 220pcs/110cartons samples for inspection, the inspector had already shown to the factory and requested to replace these defects..

AVAILABLE QUANTITY:

Order No.	Item No.	Order Qty		Packed		Not finished		Not packed		Inspect Qty	
		pcs	ctn	pcs	ctn	pcs	ctn	pcs	ctn	pcs	ctn
-	CC-140	460	230	460	230	0	0	0	0	220	110
Total:		460	230	460	230	0	0	0	0	220	110



Final Random Inspection Report

Lot Size	General Inspection Levels			Special Inspection Levels			
	I	II	III	S1	S2	S3	S4
2 to 8	A	A	B	A	A	A	A
9 to 15	A	B	C	A	A	A	A
16 to 25	B	C	D	A	A	B	B
26 to 50	C	D	E	A	B	B	C
51 to 90	C	E	F	B	B	C	C
91 to 150	D	F	G	B	B	C	D
151 to 280	E	G	H	B	C	D	E
281 to 500	F	H	J	B	C	D	E
501 to 1,200	G	J	K	C	C	E	F
1,201 to 3,200	H	K	L	C	D	E	G
3,201 to 10,000	J	L	M	C	D	F	G
10,001 to 35,000	K	M	N	C	D	F	H
35,001 to 150,000	L	N	P	D	E	G	J
150,001 to 500,000	M	P	Q	D	E	G	J
500,001 and over	N	Q	R	D	E	H	K

Single sampling plans for normal inspection

Sample Size Code Letter	Sample Size	Acceptable Quality Levels (Normal Inspection)																					
		0.065		0.10		0.15		0.25		0.40		0.65		1.0		1.5		2.5		4.0		6.5	
		Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re
A	2																				0	1	
B	3																				0	1	
C	5																				0	1	
D	8																				0	1	
E	13																				0	1	
F	20																				0	1	
G	32																				0	1	
H	50																				0	1	
J	80																				0	1	
K	125																				0	1	
L	200	0	1																		0	1	
M	315																				0	1	
N	500																				0	1	
P	800	1	2																		0	1	
Q	1250	2	3																		0	1	
R	2000	3	4																		0	1	

Inspection standard: ANSI/ASQC Z1.4-2003 Sampling plan: <i>Single, Normal</i> Inspection level: Fixed AQL: Critical: Not Allowed.	Sample Size: 220pcs			
	AQL:	0	2.5	4.0
	Defects Found:	0	18	9
	Max. Allowed:	0	-	-

This reflects our findings at the time and place in inspection. This inspection has been carried out to the best of our knowledge and ability and our responsibility is limited to the exercise of reasonable one. This report does not relieve the sellers from their contractual obligations nor prejudice buyer's right for compensation for any apparent and / or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Final Random Inspection Report


WORKMANSHIP:

Item No.	Sample size	Defective rate	Defects Description	Cri	Maj	Min
CC-140	220	0.90%	Missing ball	0	2	0
		2.27%	Lock lost function	0	5	0
		5.00%	Wheel can't be assembled	0	11	0
		1.82%	Scratches	0	0	4
		2.27%	Spraying Particles	0	0	5
Total defect:				0	18	9
Allowed:				0	-	-
Result:				Pending		

Defect Pictures:




Missing ball-maj

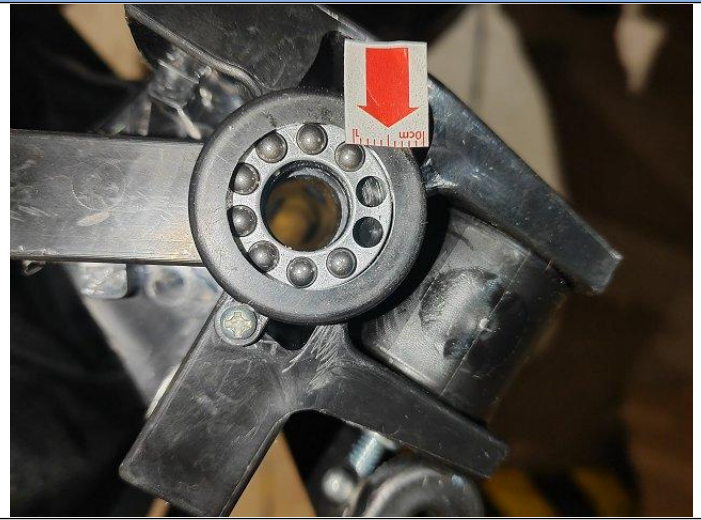

Missing ball-maj



Lock lost function-maj

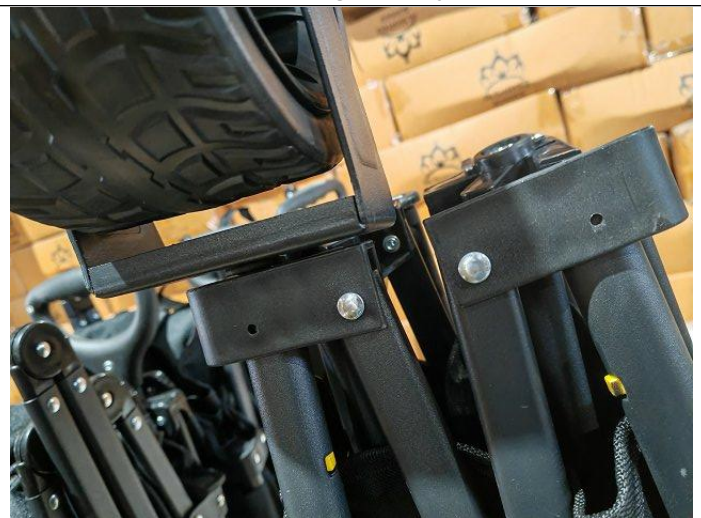

Lock lost function-maj



Lock lost function-maj




Lock lost function-maj



Lock lost function-maj



Wheel can't be assembled-maj

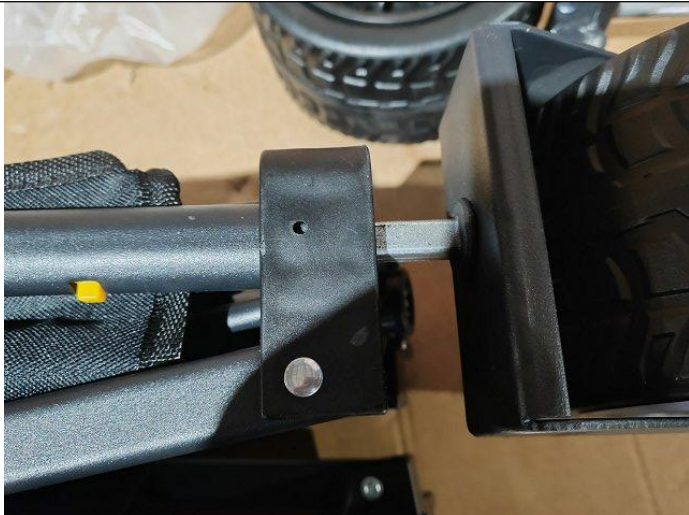

Wheel can't be assembled-maj



Wheel can't be assembled-maj



Wheel can't be assembled-maj



Wheel can't be assembled-maj



Wheel can't be assembled-maj



Wheel can't be assembled-maj



Wheel can't be assembled-maj



Wheel can't be assembled-maj



Wheel can't be assembled-maj



Wheel can't be assembled-maj



Scratches-min



Scratches-min



Scratches-min



Scratches-min



Final Random Inspection Report



Spraying Particles-min




Spraying Particles-min



Spraying Particles-min



Spraying Particles-min

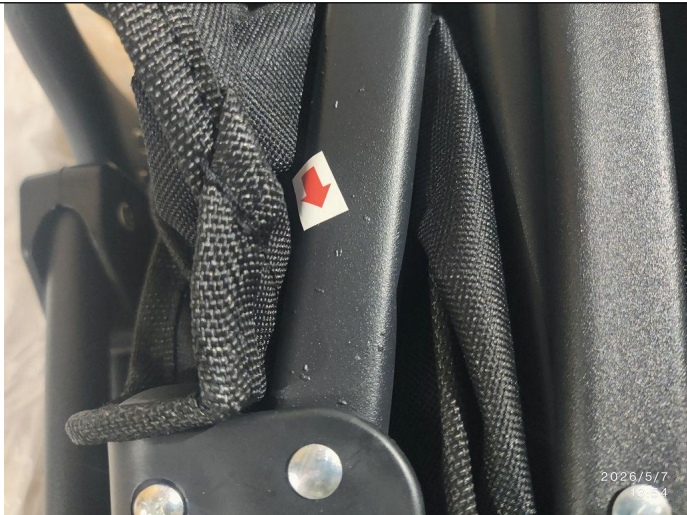

Spraying Particles-min

N/A



Final Random Inspection Report

PRODUCT CONFORMITY & ON-SITE TESTS

Check Points & On-site Tests	Sample Size	Criteria	Result & Remarks
Visual Check (Style, Appearance, Material, Color)	All Sample size	a. Conformance to Style / Appearance / Material / Color compared against: <input type="checkbox"/> Client's / <input type="checkbox"/> Factory's ref. sample. <input checked="" type="checkbox"/> No ref. sample for comparison. (N.B.: Provide details in comment section if 2 or more color shades and/or any color variation is found.) b. Free of nick, burrs, pits, sharp point or any other defects which may affect the product serviceability. c. Finish/ coating is smooth and even without streaks, blisters, wrinkles, or runs. d. Good overall appearance with good alignment of components.	PENDING Remark 2,4
Seam strength test	All Sample size	By hand force	PASS
Function check	S-2	All captioned function is well conducted as intended. Such as installation/adjusting, actual using function etc. All of function should be complied with claims.	PASS
Smell test	All Sample size	No pungent smell come out	PASS

PACKING AND ACCESSORIES:

Item No.:	Master shipper (pcs/ctn)	Carton size L×W×H (cm)	G.W (Kg)	N.W (Kg)	Color box size L×W×H (cm)	Color box weight(g)	Carton Barcode	Color box Barcode
CC-140	2	50*39*68	26.8	25.4	37.5*24*65	12.7	/	/

PRODUCT SPECIFICATION:

Item No.:	Check point	Client Spec.	Sample 1#	Sample 2#	Sample 3 #
CC-140	Size check	53*107*110	53*107*106	53*107*106	53*107*106
	Weight check	/	10.2	10.2	10.2

EXPORT CARTON INFORMATION:

Carton:	New export carton	Yes	Sealing:	Opaque gummed tape	-
Fastening:	Metal staples	Yes		Transparent gummed tape	Yes
Strapping:	Nylonx2	No		Paper tape	-
Material:	Ply of corrugated paper	5ply	Others:	-	

Product photo show:



MT-INSPECTION

Final Random Inspection Report

Report No.: MT-20260507-001



b001



b002



b003



b004



b005



b006



b007



b008



b009



b010



b011



b012



b013



b014



b015



b016



b017



b018



MT-INSPECTION

Final Random Inspection Report

Report No.: MT-20260507-001




b019




b020



b021

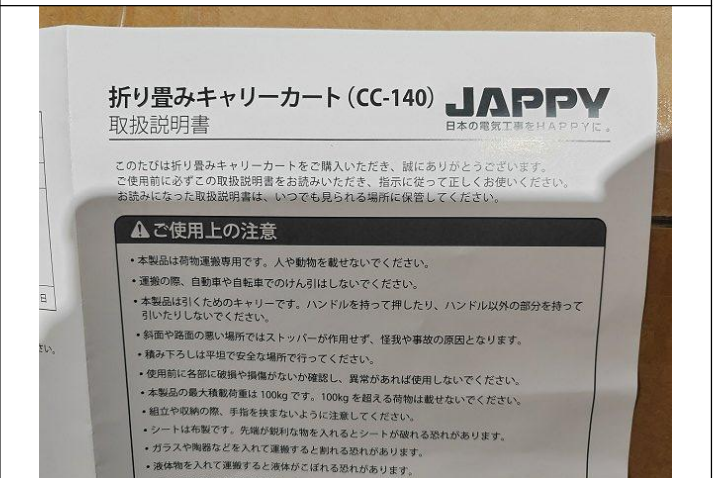


b022

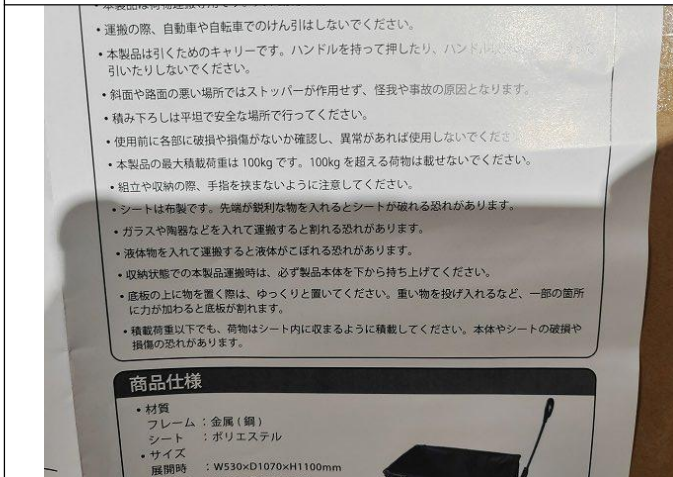


b023



b024

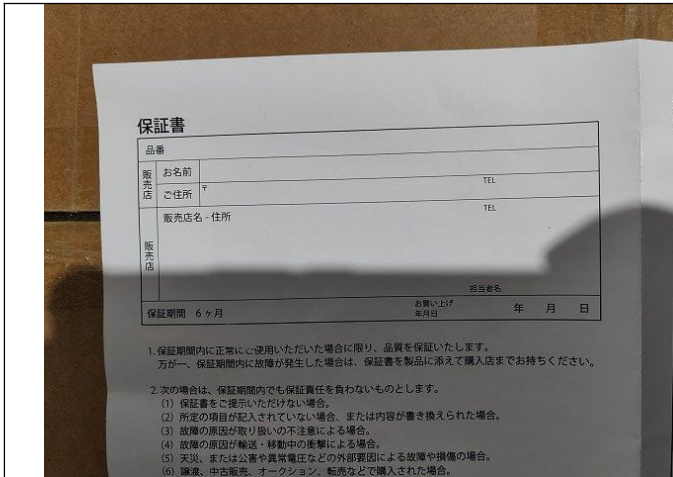


b025

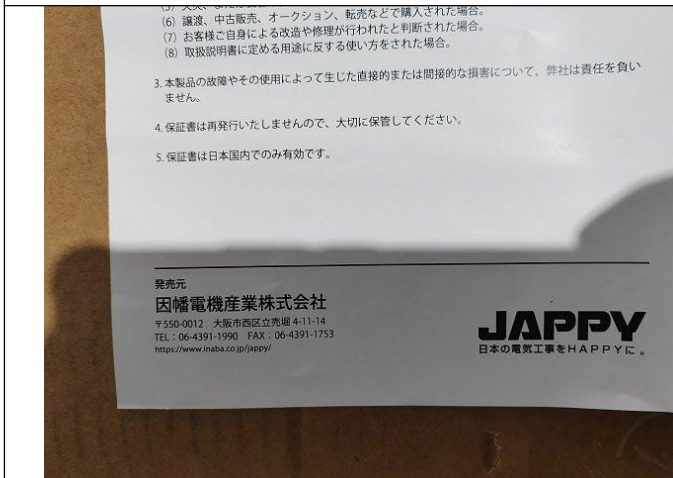

b027



b029

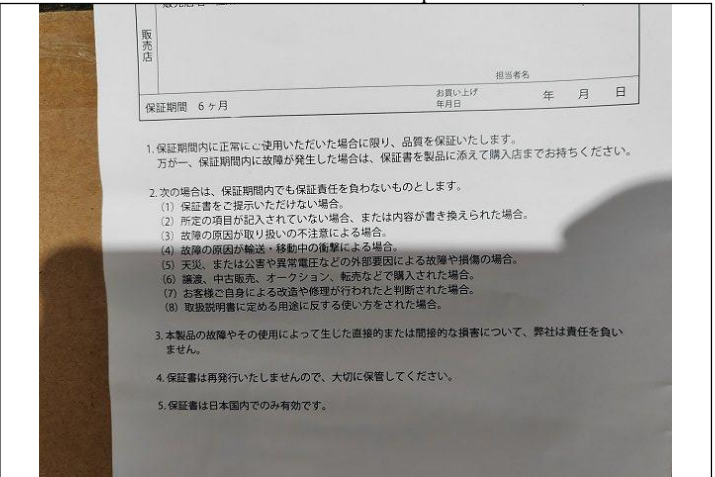

b026



b028



b030



Final Random Inspection Report

	
<p>b031</p>	<p>b032</p>
	
<p>b033</p>	<p>b034</p>
	
<p>b035</p>	<p>b036</p>



MT-INSPECTION

Final Random Inspection Report

Report No.: MT-20260507-001



b037



b038



b039



b040



b041



b042



Final Random Inspection Report



b043



b044



b045



b046



b047



b048



Final Random Inspection Report



b049



b050



b051



b054



b055



b056



MT-INSPECTION

Final Random Inspection Report

Report No.: MT-20260507-001




b057



b058



b059

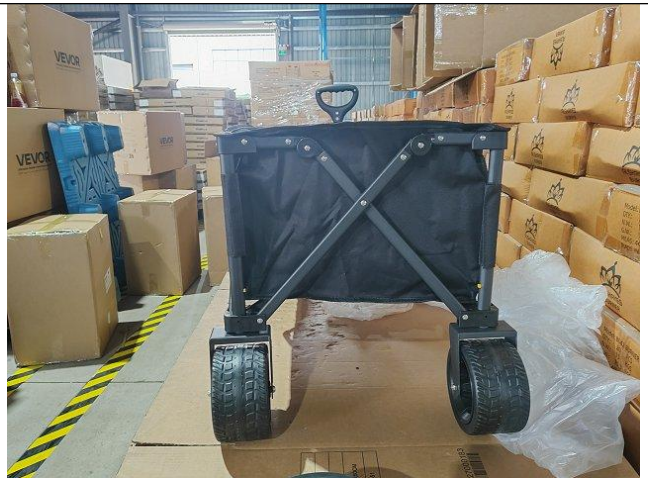

b060



b061



b062



Final Random Inspection Report



b063



b064



b065



b066



b067



b068



MT-INSPECTION

Final Random Inspection Report

Report No.: MT-20260507-001



b069



b070



b071



b072



b073



b074



MT-INSPECTION

Final Random Inspection Report

Report No.: MT-20260507-001



b075



b076




b077



b078



b079

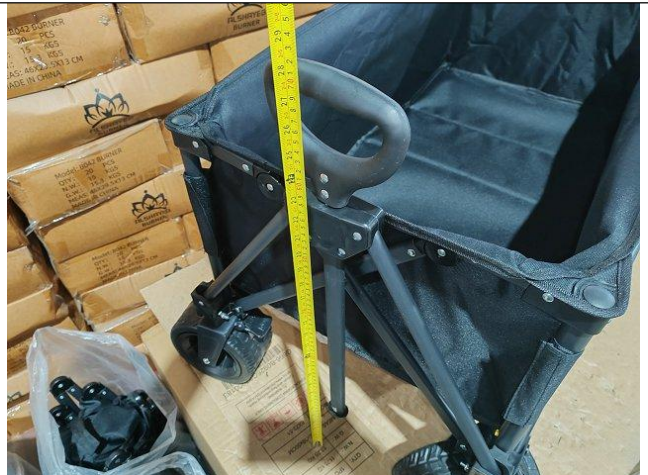

b080



MT-INSPECTION

Final Random Inspection Report

Report No.: MT-20260507-001



b081



b082



b083



b084



b085



b086



MT-INSPECTION

Final Random Inspection Report

Report No.: MT-20260507-001



b087



b088



b089



b090



b091



b092



Final Random Inspection Report



b093



b094



b095



b096



b097



b098



MT-INSPECTION

Final Random Inspection Report

Report No.: MT-20260507-001



b099



b100



b101

Nil

Nil

-The End Of Report--